(19) World Intellectual Property Organization International Bureau



(43) International Publication Date 27 June 2002 (27.06.2002)

PCT

(10) International Publication Number WO 02/50323 A2

(51) International Patent Classification7:

C22C

- (21) International Application Number: PCT/US01/47838
- (22) International Filing Date:

10 December 2001 (10.12.2001)

(25) Filing Language:

English

(26) Publication Language:

English

(30) Priority Data:

09/737,901

15 December 2000 (15.12.2000) US

- (71) Applicant (for all designated States except US): ROLLS-ROYCE CORPORATION [US/US]; P.O. Box 420, Indianapolis, IN 46206-0420 (US).
- (72) Inventors; and
- (75) Inventors/Applicants (for US only): CHESNES, Richard, P. [US/US]; 11994 Carrington Court, Cincinnati, OH 45249 (US). XU, Raymond, Ruiwen [US/US]; 1603 Springmill Boulevard, Carmel, IN 46032 (US).
- (74) Agents: THOMAS, Timothy, N. et al.; Woodard, Emhardt, Naughton, Moriarty & McNett, Suite 3700, Bank One Center/Tower, 111 Monument Circle, Indianapolis, IN 46204 (US).

- (81) Designated States (national): AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TR, TT, TZ, UA, UG, US, UZ, VN, YU, ZA, ZM, ZW.
- (84) Designated States (regional): ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, CH, CY, DE, DK, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG).

Published:

 without international search report and to be republished upon receipt of that report

For two-letter codes and other abbreviations, refer to the "Guidance Notes on Codes and Abbreviations" appearing at the beginning of each regular issue of the PCT Gazette.

BEST AVAILABLE COPY

50323

(54) Title: NICKEL DIFFUSION BRAZE ALLOY AND METHOD FOR REPAIR OF SUPERALLOYS

(57) Abstract: A braze alloy powder mixture that includes a low-melt powder composition and a high-melt powder composition. The low-melt powder composition is made of one or more low-melt powders and includes 50-70 % Ni, 8-20 % Cr, 8-15 % Ta, 4-10 % Co, 2-7 % Al, and up to 2.25 % B. The high-melt powder composition is made of one or more high-melt powders and includes 50-70 % Ni, 2-10 % Cr, 2-10 % Ta, 5-15 % Co, 2-10 % Al, 2-10 % W, and up to about 3 % each of Re, Mo and Hf. Up to about 1 % Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and/or Zr may be included in the low-melt powder, while the high-melt powder may include up to about 1 % each of Ti, Nb, C, B, Si, and Zr.

WO 02/50323 PCT/US01/47838

NICKEL DIFFUSION BRAZE ALLOY AND METHOD FOR REPAIR OF SUPERALLOYS

The present invention relates generally to compositions and methods for repairing superalloys, and more particularly to compositions and methods for the braze repair of nickel- and/or cobalt-based superalloy parts.

BACKGROUND OF THE INVENTION

Nickel- and/or cobalt-based superalloys are commonly used by the aerospace and power industries for components such as turbine vanes that will be subjected to high temperatures and stress. While such alloys are inherently strong and resistant to damage, cracks and ruptures occasionally occur. When the damage is relatively minor, repairs can be made, such as, for example, by braze repair.

High temperature diffusion braze technology is normally used to repair turbine vanes made of Ni- and Co-based superalloys. The braze alloy mixture typically includes two powdered constituents. The first constituent (the base metal powder) is a high temperature powder with a chemistry the same as, or similar to, the component being repaired. The second constituent (the braze alloy powder) consists of a high temperature diffusion braze alloy that has a melting temperature well below that of the base metal powder. This braze alloy powder is used to join the base metal powder particles together, and to join the composite powder mixture to the areas of the component being repaired.

Diffusion braze alloy powders typically contain melting point depressants such as boron and/or silicon of elements. Unfortunately though, the use of boron and silicon in braze alloys can have a negative impact on the mechanical and/or environmental properties of the repaired area of the part. In particular, large, blocky or script-like brittle phases are formed which decrease the ability of the material to resist rupture from stress. These brittle phases are composed of refractory elements, chromium, and/or titanium combined with boron, silicon and carbon. For the braze repair of directional solidified (DS) superalloys with

BNSDOCID: <WO_____0250323A2_1_>

5

15

20

25

30

columnar-grained (CG) and single-crystal (SC) microstructure, B and Si are particularly detrimental to the mechanical properties and oxidation resistance.

A need therefore exists for improved braze repair alloy powders with minimal amounts of B and/or Si, that can be used for repairing superalloys such as those found in jet engine turbine vanes. The present invention addresses that need.

BNSDOCID: <WO_____0250323A2_I_>

10

15

20

25

SUMMARY OF THE INVENTION

Briefly describing one aspect of the present invention, there is provided a braze alloy powder mixture comprising a low-melt powder composition and a high-melt powder composition. The low-melt powder composition may be made from a single low-melt alloy powder, or it may be a mixture of more than one low-melt alloy powder. In either event, the low-melt powder composition preferably comprises, by weight, 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to about 2.25% B. Similarly, the high-melt powder composition may be made from a single high-melt alloy powder, or it may be a mixture of more than one high-melt alloy powder. In either event, the high-melt powder composition preferably comprises, by weight, 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, and up to about 3% each Re, Mo and/or Hf.

In the most preferred embodiments the low-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and Zr, and the high-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, Nb, C, B, Si, and Zr.

Accordingly, the braze alloy mixture (that is, the combination of low-melt and high-melt powders) preferably comprises 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-7% Al, 2-4% W, about 1-2% Re, and about 0.5-1% each of Mo and Hf. In the most preferred embodiments the braze alloy mixture also comprises up to about 1% each of any or all of the following: Ti, Nb, Pd, Pt, Ir, Ru, C, B, Si, and Zr.

One object of the present invention is to provide braze alloy powders useful for the braze repair of Ni- and/or Co-based superalloys.

Other objects and advantages will be apparent from the following description.

BNSDOCID: <WO____0250323A2_I_>

BRIEF DESCRIPTION OF THE DRAWINGS

FIG. 1 is a graph showing the results of a stress rupture test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.

FIG. 2 is a graph showing the results of a low cycle fatigue test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.

10

15

FIG. 3 is a graph showing the specific weight change during a cyclic furnace oxidation test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.

FIG. 4A shows an engine vane segment with fine cracks in the vane.

FIGS. 4B and 4C show cracks in an engine vane segment such as that shown in FIG. 4A, after repair with the inventive braze repair alloy powders of the present invention.

20

FIGS. 5A and 5B show leading and trailing edge sides of a vane segment prior to (5A) and after (5B) braze repair using the inventive braze repair alloy powders of the present invention.

10

15

20

25

30

DESCRIPTION OF THE PREFERRED EMBODIMENTS

For the purposes of promoting an understanding of the principles of the invention, reference will now be made to certain preferred embodiments and specific language will be used to describe the same. It will nevertheless be understood that no limitation of the scope of the invention is thereby intended, such alterations and further modifications in the illustrated device, and such further applications of the principles of the invention as illustrated therein being contemplated as would normally occur to one skilled in the art to which the invention relates.

As indicated above, one aspect of the present invention relates to powders useful for the braze repair of superalloy components such as turbine vanes. In a preferred embodiment one or more low-melt alloy powders is mixed with one or more high-melt alloy powders to form a powdered braze alloy mixture that can be used for the repair.

Another aspect of the invention relates to methods of repairing superalloy components by using the subject braze alloy mixtures at braze temperatures of about 2300°F, followed by a stepped, diffusion heat treatment cycle at temperatures ranging from about 1900°F to about 2100°F.

1. Substrates.

The braze repair compositions and methods of the present invention can be used to repair a wide variety of substrates, including nickel- or cobalt-based alloy substrates. Specific examples of alloys that can be repaired with the compositions and methods of the present invention include, but are not limited to: nickel-based alloys such as Mar-M246, Mar-M247; single crystal nickel alloys such as CMSX-3, CMSX-4, and CM-186; and cobalt-based alloys such as Mar-M509 and X40.

2. <u>Braze Alloy Powders, and Mixtures Thereof.</u>

The braze alloy powder mixtures of the present invention include both a low-melt powder composition and a high-melt powder composition. The low-melt alloy powder composition is an alloy, or a mixture of alloys, that substantially melts below the braze temperature (hence the name "low-melt"). In contrast, the high-melt alloy powder composition is an alloy, or a mixture of alloys, that remains substantially unmelted at braze temperatures because the

10

15

20

25

30

composition has a melting temperature <u>above</u> the braze temperature (hence the name "high-melt").

In the preferred embodiments of braze repair mixtures used to repair Ni-based superalloys such as MAR-M247 or CMSX-3, the low-melt powder composition is preferably made from a mixture of alloys that melt below about 2250°F, with the combination of alloys being selected so that the low-melt powder composition as a whole substantially melts in the range of about 2100°F +/- 100°F. The high-melt alloy powder composition used in such embodiments is preferably made of a single high-melt alloy that doesn't melt until it gets above about 2400°F.

In the most preferred embodiments the low-melt powder composition accordingly comprises one or more alloy powders and has a resulting composition of about 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to about 2.25% B and/or Si, by weight, and has a compositional melting range of between about 2000°F and 2250°F. In certain preferred embodiments the low-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, and Zr.

Most preferably, the alloys used to prepare the low-melt alloy powders each contain between about 0.65 and about 2.25% B, with the total amount of B in the low-melt powder composition preferably being between about 1% and 2%. The low-melt alloy powders each also preferably contain up to about 3% Si, with the total amount of Si in the low-melt powder preferably being between about 0.5% and 1%.

The high-melt powder composition preferably is an alloy (or mixture of alloys) with a chemistry that is the same or substantially the same as the alloy in the substrate to be repaired. Accordingly, to repair Ni-based superalloy components such as those made of MAR-M246 or 247, or CMSX-3 or -4, the high-melt powder composition typically comprises about 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, 2-4% Re, and up to about 3% each of Mo and Hf. In the most preferred embodiments the high-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, Nb, C, B, Si, and Zr.

10

15

20

25

30

The low-melt alloy composition and the high-melt alloy composition are generally combined at ratios of about 1:3 to about 3:1 low-melt:high-melt powder, with ratios of 1:2 to 2:1 being more preferred. In the most preferred embodiments, the ratio of low-melt powder to high-melt powder is typically in the range of 1:1 to 1:1.5.

In testing to date, compositions comprising about 40-50% low-melt alloy powder, and about 50-60% high-melt powder has been preferred for repairing Ni-based superalloy parts such as vanes made of CMSX-3. A ratio of about 45:55 low-melt:high-melt powders has been most preferred for those Ni-based superalloy repairs.

In selecting the proportions of components used in the invention, it should be recognized that higher weight percentages of high-melt powder typically provide better mechanical properties in view of their reduced levels of boron and/or silicon. Similarly, higher percentages of low-melt powders typically have improved braze flow. As can be appreciated by persons skilled in the art, a proper balance between mechanical properties and braze flow must be established, as dictated by the demands of a particular application.

Higher Al content is also desired in some embodiments because Al-rich compositions improve high-temperature oxidation properties. Further, increasing the Ta content in the mixtures improves the braze joint mechanical properties. In particular, Ta additions strengthen the gamma and gamma prime phases by increasing lattice mismatches.

In view of the above, it can be seen that the final braze alloy repair mixture preferably comprises 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-7% Al, 2-4% W, 1-2% Re, and about 1% each of Mo and Hf, and most preferably also comprises up to about 1% each of any or all of the following: Ti, Nb, Pd, Pt, Ir, Ru, C, B, Si, and Zr.

As indicated above, in certain preferred embodiments the low-melt alloy powder comprises a mixture of two or more low-melt alloys. In one preferred embodiment particularly useful for repairing Ni-based superalloy parts, the low-melt alloy powder comprises: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B, with a

10

15

20

liquidus temperature of about 2050°F; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B, with a liquidus temperature of about 2250°F; and (c) about 20% of a third low-melt powder comprising about 64% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B, with a liquidus temperature of about 2000°F.

In one preferred embodiment the high-melt powder composition comprises about 55-60% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.

Table 1 below shows the compositions, by weight %, of three potential low-melt alloys (ADB-01, ADB-02, and ADB-03) and one potential high-melt alloy (HMA-01). In the most preferred embodiments these alloys are combined such that the low-melt alloy powder comprises about 35% ADB-01, about 45% ADB-02, and about 20% ADB-03. One preferred braze repair powder comprises 45% of this mixture of low-melt powders, and 55% of this preferred high-melt powder.

Table 2 below shows other low-melt and high-melt alloy powders that may be used in the present invention. (It is to be appreciated that Table 2 is for illustrative purposes, and that not all low-melt or high-melt powders are shown in Table 2.) Table 3 shows braze repair alloy mixtures of those low-melt and high-melt alloy powders. (It is also to be appreciated that Table 3 is for illustrative purposes, and that not all mixtures of low-melt and high-melt powders are shown in Table 3.)

Table 1. BRZAE ALLOY COMPOSITIONS by weight percent

¥	.01 тах	.01 тах	.005 max	.30 max								
Pd	.01 max	.01 max	хат 200.			z	.0300 тах	.0300 max	.0300 тах			
S	.05 max	.05 max	2.75-3.25	.06 тах		Mg	.01 тах	.01 тах	.01 max	.0035max		
В	2.00-2.25	.85-1.15	1.20-1.40	.0102		ಕ	.1 max	лах Г.	.l max	.1 тах		
C	**.02 max	**.02 max	** .02 max	.1014		>	.1 тах	.1 max	. I max	2 тах		
JH	.01 max	xmm 10.	0.40-0.60	1.30-1.70		Fe	.1 max	.1 max	xem 1.	.l max		
₽ R	.01 так	.01 max	1.00-1.50	0.10max		а.	.015 max	.015 max	.015 тах	.010 max		
Ta	xem 10.	25.8-26.2	4.00-4.50	6.20-6.50		S	.0010 max	.0010 тах	.0002 max	.0040 max		
Re	x12m 10.	.01 max	1.00-1.50	2.60-3.00		0	#.0300 nax	#.0300 max	.0100 max	#.0300 max		
Mo	жтш 10'	.01 max	.01 max	1.30-1.70		Mn	.01 max	.01 max	.01 max	.01 max		
*	.01 max	.01 max	3.25-3.75	4.70-5.10		•Ce	.005 тах	.005 max	.005 max			
င့	11.25-12.25	.05 пях	7.75-8.25	11.45-12.05		La	.005 max	.005 max	.005 тах			
Ti	.01 max	.01 max	.01 max	0.02max		Y	.005 max	.005 тах	.005 max			
٧ı	6.15-6.35	.01 max	6.15-6.35	5.94-6.30		Ru	.01 max	.01 max	.01 max		1	
చ	5.75-6.25	30.8-31.2	5.9-6.10	00'1-09'9		lr	хвш 10.	.01 тах	.01 тах		ì	
Z	BAL.	BAL.	BAL.	BAL.		Tr.	.01 тах	.01 max	жи 500.	.030 пах		
Alloy	ADB-01	ADB-02	ADB-03	HMA-01		Alloy	ADB-01	ADB-02	ADB-03	HMA-01		

BNSDOCID: <WO_____0250323A2_I_>

TABLE 2. BRZAE ALLOY COMPOSITIONS
by weight percent

																1 ()																 	 _
ŭ	005 may	OOF max	005 max	.005 max	.005 max	.01 max	.01 тах	.01 max	.01 max	.005 max	.005 max	.005 max																						
75	50.55	30.35	55.60	325-3.75	.05 max	.05 тах	.05 max	.05 max	.05 max	.05 max	2.75-3.25	.05 max	0.015																					
8	AG. SK	10.1%	85.55	1.20-1.50	2.40-2.60	2.00-2.25	.01 тах	.85-1.15	1.60-1.80	.01 max	1.20-1.40	.01 max	3	on additions																				
S	15.15	21.00. 01 may	5 5	8.	*.02 mgx	*.02 max	02 max	02 max	**.02 max	.0204	02 max	.0204	0.062	** With no carbon additions																				
2	Of may	Yam 10	Of max	.01 шах	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max		Ė																				
=	Of may	Jan S	Of may	Of max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max				i i																		
E	Vor may	.00. 76 75. 76	ONS may	005 max	.005 max	.01 тах	.01 max	.o. max	.01 max	.005 max	.005 max	.01 max				Ì																		
Pq	976.906	25.75	005 may	5.75-6.25	25-75	.01 max	.01 max	.01 mex	.01 max	.01 max	.005 max	59.5-60.5				İ		z		.0300 max	.0300 шах	.0300 тах	.0300 max	.0300 max	.0300 max	.0300 max	.0300 max							
Ξ	300	. Illex	20 00 00	+	┢	.01 max	.01 max	.01 max	.01 тах	.01 max	0.40-0.60	.01 mex			-			EM9		.01 max	.01 тах	01 max	.01 mgx	Wam 10.	.01 max	.01 так	.01 mgx	.01 max	.01 тах	.01 max	.01 тах			
£	70 00	X a	Jo mor	10 max	.10 max	.01 max	.01 mex	.01 max	.01 max	.01 max	1.00-1.50	.01 max	2			-		3		.1 max	.1 тах	.1 max	.1 max	.1 mex	, max	.1 max	.1 max	.1 max	.1 max	.1 mex	.1 max			
4	7 76 0 98	0.75.40.95	10 75.11 95	10.75-11.25	6,25-6,50	.01 max	.01 mex	25.8-26.2	29.8-30.2	6.25-6.50	4.00-4.50	.01 шах	4					>		.1 max	.1 max	- max	.1 mex	.1 mex	,1 max	.1 mex	.1 max							
æ	3	XBM 10.	╁	十	十	┼~	.01 max	.01 max	.01 max	.01 max	1.00-1.50	.01 max				<u> </u>		E.		.1 max	.1 тах	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max							
Mo	100	SE 5	, , , , , , , , , , , , , , , , , , ,	a se	жш 10	.01 max	ж ш 10.	.01 max	.01 max	.01 тах	.01 max	.01 тах	2			:		a		.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max							
*	30 0 00	1.75-225	20.024	1 25.1 75	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	3.25-3.75	.01 max	-		-			S		.0002 max	.0002 max	.0002 max	.0002 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	.0002 max	# .0010 max			
ಕ	20 77 87	10.75-11.25	50.75 44 0E	11 95,19 95	11.25-12.26	11.25-12.25	.05 max	36. Walk	됢	11.25-12.25	7.75-8.26	.01 max	6			1		•		.0100 max	.0100 max	.0100 mex	.0100 max	#.0300 max #.0010 max	#.0300 msx 8 .0010 max	#.0300 max # .0010 max	.0100 max							
F	7	Т	Tam to	+-	1-	+-	1	.01 max	.01 max	\vdash	+-	.01 max						ş	-	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max							
7	10.1	4.75-5.25	4.70-5.23	4.75.5.05	6 15-8 35	6.15-6.35	54.75-55.25	.01 max	.01 max	6.15-6.35	6.15-6.35	.01 max	9		+			3::		.005 max	.005 max	.005 max	.005 max	.005 тах	.005 max	,005 max	.005 max	.005 тах	.005 тах	,005 тах				
ď	\vdash	╫	╫	6.05.6.75	┿	╁	t	+	.01 max	╁	╁	.01 max			+	-		5		.005 max	.005 max	.005 max	.005 max	.005 max	.005 max	.005 max								
2	H	\dagger	3 3	\dagger	\dagger	+	╁.	W.	S max	8	¥ X	AS I	Æ					>		.005 max	.005 max	.005 тах	.005 max	.005 тах	.005 max	.005 тах	.005 max	.005 max	.005 max	.005 max				
ALLOY		ADB-101	AUB-102	200	2 40	ADB-O1	ADB-108	ADB-02	ADB-110	ADB-111	ADB-03	ADB-114	BCT.					ALLOY		ADB-101	ADB-102	ADB-103	ADB-104	ADB-106	A08-01	ADB-108	A08-02	ADB-110	ADB-111	ADB-03	ADB-114			

TABLE 3. BRAZE ALLOY MIXTURES AND TEST NOTES

Mixture #	Alloy Mixture	Comments
MM-29		Alloy densified. Bright shiny sliver surface. Good wet-out. 100% slot fill.
MM-36	Mar-M247/ADB-03/ADB-106 40/30/30	Alloy densified. Bright shiny silver surface. Good wet-out, 100% slot fill.
MM-37		Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
MM-39		Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
MM-45	104 20/20/30/30	Alloy densified. Bright shiny silver surface. Good wet-out. 100% stot fill.
MM-47		Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
MM-51	Mar-M247/ADB-03/ADB-114 60/20/20	Less slot fill than MM-50.
MM-52	Mar-M247/ADB-03/ADB-114 40/35/25	Alloy densified. Bright shiny silver surface. Excellent wet-out. 100% slot fill.
69-WW	Mar-M247/ADB-02 40/60	Excellent flow and complete slot fill.
MM-70	Mar-M247/ADB-02/ADB-114 50/40/10	Excellent flow and complete slot fill.
MM-72	Mar-M247/ADB-02/ADB-03 50/40/10	Excellent flow and complete slot fill.
MM-73	Mar-M247/ADB-02/8-28 50/40/10	Excellent flow and complete slot fill.
MM-74	Mar-M247/ADB-02/B-28/ADB-114 50/35/10/5	Excellent flow and complete slot fill,
MM-75	Mar-M247/ADB-02/ADB-03/ADB-114 50/35/10/5	Excellent flow and complete slot fill.
MM-106	. 01/c	Excellent flow and complete slot fill.
- 1		RX in SX-3 near braze; Excellent flow and complete slot fill.
- 1		Excellent flow and complete slot fill.
- !		Excellent flow and complete slot fill.
- 1		Stuggish flow and complete slot fill. 5-10% voids in bead
- 1	/10	Excellent flow and complete slot fill. 100% RX in SX-3 interface.
	HMA-01/ADB-01/ADB-02 60/10/30	Sluggish flow and complete stot fill. A lot voids in bead.
MM-130	HMA-01/ADB-01/ADB-02 65/25/10	Excellent flow and complete slot fill. 100% RX in \$X-3 interface.
MM-131	HMA-01/ADB-01/ADB-02 60/25/15	Excellent flow and complete slot fill. 100% RX in SX-3 interface.
MM-133	HMA-01/ADB-01 60/40	Excellent flow and complete slot fill.
MM-135	HMA-01/ADB-01 70/30	Excellent flow and complete slot fill,
MM-136	HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/15	Excellent flow and complete slot fill.
MM-137	HMA-01/ADB-01/ADB-02/ADB-03 55/15/20/10	Excellent flow and complete slot fill.
MM-140	HMA-01/ADB-03 60/40	Excellent flow and complete slot fill,
MM-141	HMA-01/ADB-106/ADB-03 60/20/20	Excellent flow and complete slot fill.
MM-142	HMA-01/RCT-4/ADB-02 60/20/20	Excellent flow and complete slot fill,
MM-143	HMA-01/RCT-4/ADB-02 60/30/10	Good flow and complete slot fill,
MM-144		Good flow and complete slot fill.
MM-145	HMA-01/RCT-12/ADB-110 60/30/10	Excellent flow and complete slot fill.

3. Methods of Use

The following steps are typical for the braze repair processes of the present invention. It is to be appreciated that certain steps may be adjusted, or even omitted, depending on the nature of the component being repaired.

5

The first steps normally involve the inspection and cleaning of the component. Initially, chemical and mechanical cleaning processes are generally used to remove dirt, debris, grease, oils, and loose scale from the component. Following that, chemical stripping may be required to remove any coatings that may be present. Then, fluoride ion cleaning (FIC) may need to be used to remove complex oxides from the surface and from inside cracks. Finally, high-temperature vacuum cleaning may be required to remove residual oxides and fluoride ions from the FIC process. All of these methods are generally known to the art, and can be incorporated into the inventive process on an "as needed" basis without undue experimentation.

15

20

10

Following cleaning, the high temperature braze repair is begun. In that process, the braze repair alloy powder is made into a slurry (preferably using a binder effective to hold the powders together and to help hold the powders on the surface being repaired) and is applied to the surface. The component is then heated in a vacuum or in an inert gas to a temperature effective to melt the low-melt alloy so that the braze material fills the crack being repaired. In the preferred embodiments the braze temperature is between 2150°F and 2350°F, with braze temperatures of about 2300°F being most preferred. The braze time may vary from about 10 minutes to about 40 minutes, with braze times of about 20 to 30 minutes being most commonly used.

25

Following the brazing itself, the component is subjected to a diffusion heat treatment cycle to homogenize the repaired region. The diffusion heat treatment is preferably performed at temperatures 0-400°F below the braze temperature, and for times of up to about 24 hours. A vacuum or inert atmosphere is preferably used for the diffusion heat treatment.

30

In certain preferred embodiments the heat diffusion cycle is performed for a time and at temperatures effective to break down the script-like silicide phases into fine discrete particles. The cycle also preferably is performed for a time and at temperatures effective to reduce the size and quantity of brittle boride phases.

In one preferred embodiment the diffusion cycle is a stepped heat cycle, as follows:

5

20

- a. Heat part to 1800-2000°F and hold for 0.5-4 hours;
- b. Heat part to 1900-2100°F and hold for 1-4 hours;
- c. Heat part to 1950-2150°F and hold for 1-4 hours;
- d. Heat part to 2000-2200°F and hold for 6 to 24 hours; and
- e. Cool to ambient temperature.
- The heating is preferably accomplished at a rate such that the first heating step is performed at a rate of about 20-40°F per minute, the second heating step is performed at a rate of about 10-30°F per minute, the third heating step is performed at a rate of about 5-20°F per minute, the fourth heating step is performed at a rate of about 5-20°F per minute.
- In the most preferred embodiment the diffusion cycle is a stepped heat cycle, as follows:
 - a. Heat part to about 1900°F at about 30°F per minute and hold for 1 hour:
 - b. Heat part to about 2000°F at about 20°F per minute and hold for 2 hours;
 - c. Heat part to about 2050°F at about 10°F per minute and hold for 2 hours;
 - d. Heat part to about 2100°F at about 10°F per minute and hold for 8 to 18 hours;
- e. Vacuum or inert gas furnace cool to about 1200°F at a rate which is slow enough to avoid thermal distortion; and
 - f. Inert gas fan cool to about 150°F or less.

Reference will now be made to specific examples using the processes

described above. It is to be understood that the examples are provided to more completely describe preferred embodiments, and that no limitation to the scope of the invention is intended thereby.

EXAMPLE 1

Braze Alloy Repair

A braze repair alloy mixture is prepared by combining: (a) about 15% of a first low-melt alloy powder comprising 5.75-6.25% Cr, 6.15-6.35% Al, 11.25-5 12.25% Co, 2-2.25% B, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); (b) about 20% of a second low-melt alloy powder comprising 30.8-31.2% Cr, 25.8-26.2% Ta, 0.85-1.15% B, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); (c) about 10% of a third alloy powder comprising 5.9% Cr. 10 6.15-6.35% Al, 7.75-8.25% Co, 3.25-3.75% W, 1-1.5% Re, 4-4.5% Ta, 1-1.5% Nb, 0.4-0.6% Hf, 1.2-1.4% B, 2.75-3.25% Si, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); and (d) about 55% of a high-melt powder comprising 6.6-7% Cr, 5.9-6% Al, 11.4-12.1% Co, 4.7-5.1% W, 1.3-1.7% Mo, 2.6-3% Re, 6.2-6.5% Ta, 1.3-1.7% Hf, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components 15 and/or impurities).

The braze repair alloy powder is made into a slurry using a commercially available binder, and is then applied to a clean surface of a Ni-based superalloy material and the component is heated in a vacuum to a braze temperatures of about 2300°F for about 20 minutes.

Following brazing, a stepped diffusion heat cycle is used, as follows:

- a. Heat to 1900°F at 30°F per minute and hold for 1 hour.
- b. Heat to 2000°F at 20°F per minute and hold for 2 hours.
- c. Heat to 2050°F at 10°F per minute and hold for 2 hours.
- d. Heat to 2100°F at 10°F per minute and hold for 8 to 18 hours.
- e. Cool to 1200°F at a rate effective to avoid thermal distortion, and hold for at least 5 minutes.
 - f. Cool to 150°F or less.

20

10

15

20

25

30

EXAMPLE 2

Stress Rupture Testing

Stress rupture (S/R) tests were performed on representative base metals, and on articles repaired using a preferred embodiment of the inventive powder mixture and repair process. In one aspect of the test, base metal materials such as MAR-M247 and CMSX-3 were subjected to heat treatments corresponding to the steps used in the present invention (e.g., heating to braze temperature, followed by a typical stepped heat diffusion cycle) to test the effect of the inventive method on the base materials themselves. The test conditions for the base metal tests were 1800°F and 36 Ksi.

In another aspect of the S/R test, repaired parts were tested to determine the mechanical properties of parts repaired by the inventive process. The test conditions for repaired parts were 2000°F and 5 Ksi for parts in which a 0.005-inch gap was repaired, and 2000°F and 3 Ksi for parts in which a 0.040-inch gap was repaired.

The test results indicate that the braze repair process of the present invention does not cause any significant negative impact on the mechanical properties of the base metal, such as CMSX-3. Moreover, the repaired parts exhibited mechanical properties comparable to unrepaired superalloys such as MAR-M247.

For example, the average time to stress rupture for repaired parts that had a 0.005" gap (test at 2000°F and 5 Ksi) was 46.98 hours for uncoated parts and 186.48 hours for parts coated with standard Pt/Al coatings. The time to rupture for coated 0.04"-gap parts was 153.34 hours (test at 2000°F and 3 Ksi). This compares favorably to the performance of undamaged parts made from MAR-M247, whether uncoated or coated with standard Pt/Al coatings.

FIG. 1 shows the results of S/R testing. As can be seen from the graph, the mechanical performance of parts repaired by the compositions and methods of the present invention compares favorably with the mechanical performance of undamaged MAR-M247 parts.

10

15

20

- . . 25

30

EXAMPLE 3

Low Cycle Fatigue Testing

Low cycle fatigue (LCF) tests were performed on representative base metals, and on articles repaired using a preferred embodiment of the inventive powder mixture and repair process. For the low cycle fatigue (LCF) tests, the test conditions were 1900° F, R = 0, 0.53% strain, and a frequency of 20 CPM for.

FIG. 2 shows the results of the LCF testing. As can be seen from the graph, the mechanical performance of parts repaired by the compositions and methods of the present invention compares favorably with the mechanical performance of undamaged MAR-M247 parts.

EXAMPLE 4

Cyclic Oxidation Testing

Cyclic oxidation tests were also performed on the brazed specimens using a cyclic oxidation test cycle of 2075°F for 50 minutes and fan cool at room temperature for 10 minutes. The specimens consisted of base material and brazed samples, both with compatible PtAl coatings.

The inventive braze alloy mixtures performed much better than prior art braze mixtures during the tests. The most preferred embodiments achieved a more than 10-fold improvement of oxidation properties over diffusion braze alloy systems due to the lower percentage of boron and the higher percentage of aluminum.

FIG. 3 shows the specific weight change during cyclic furnace oxidation test at 2075°F for 500 cycles. (Five hundred cycles was selected to as a reasonable approximation of target engine flight life.) Sample weight changes were in weight gain or weight positive gain but decreasing weight. The samples gain weight due to the formation of protective oxides, which are primarily aluminum oxides. Some oxide spelling-off could result in reduction in weight. But protective layers still remain on the surface and Al can diffuse from the braze mixture to the surface to form new protective oxide. Negative weight gain is not desirable, and almost never occurred in the 500 cycle tests.

10

As shown by the above, it is to be appreciated that the microstructure of joints brazed with the technology of the present invention contains very few, if any, phases that would be detrimental to the joint mechanical and oxidation properties. The inventive mixtures also possess acceptable level of braze voids after brazing process.

While the invention has been illustrated and described in detail in the drawings and foregoing description, the same is to be considered as illustrative and not restrictive in character, it being understood that only the preferred embodiment has been shown and described and that all changes and modifications that come within the spirit of the invention are desired to be protected.

15

CLAIMS

What is claimed is:

- 1. A braze alloy powder composition comprising: (a) at least one low-melt alloy powder, and (b) at least one high-melt alloy powder; wherein said at least one low-melt alloy powder comprises 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to 2.25% B, and wherein said at least one high-melt alloy powder comprises 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, 2-4% Re, and up to 3% each of Mo and Hf.
- 2. A braze alloy powder composition according to claim 1 wherein said at least one low-melt alloy powder also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and Zr.
 - 3. A braze alloy powder composition according to claim 1 wherein said at least one high-melt alloy powder also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, Nb, C, B, Si, and Zr.
 - 4. A braze alloy powder composition according to claim 1 wherein said at least one low-melt powder comprises about 57% Ni, about 17% Cr, about 12% Ta, about 6% Co, about 3.5% Al, and about 1.5% B.
- 5. A braze alloy powder composition according to claim 1 wherein said at least one low-melt powder comprises a mixture of three low-melt alloy powders, including: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third low-melt powder comprising about 6% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B.
 - 6. A braze alloy powder composition according to claim 1 wherein said at least one high-melt powder composition comprises about 58% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.

10

15

- 7. A braze alloy powder composition according to claim 1 wherein said composition comprises about 45% of said at least one low-melt alloy powder and about 55% of said at least one high-melt alloy powder.
- 8. A braze alloy powder composition according to claim 1 wherein said composition comprises about 45% of said at least one low-melt alloy powder and about 55% of said at least one high-melt alloy powder, wherein said at least one low-melt alloy powder comprises a mixture of three low-melt alloy powders, including: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third low-melt powder comprising about 65% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 0.5% to 1.5% each of Re, Nb, Hf, and B; and wherein about 55% of a high-melt alloy powder comprising about 59% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.
 - 9. A braze alloy mixture consisting essentially of 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-6% Al, 2-4% W, and about 1% each of Mo, Re, and Hf.
- 10. A braze alloy mixture consisting essentially of about 58% Ni, about 20 11% Cr, about 9% Ta, about 9% Co, about 5% Al, about 3% W, and about 1% each of Mo, Re, and Hf.
 - 11. A braze alloy mixture according to claim 8 wherein said mixture also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, Nb, Pd, Pt, Ir, Ru, C, Si, B, and Zr.
- 25 12. A method of repairing an article made of a nickel-based superalloy material, said method comprising:
 - (a) providing a braze alloy powder composition comprising:
 - (i) at least one low-melt alloy powder, and
 - (ii) at least one high-melt alloy powder; wherein said at least one low-melt alloy powder comprises 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to 2.25% B; and

wherein said at least one high-melt alloy powder comprises 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, and up to 3% each of Mo, Re, and Hf;

- (b) brazing a damaged portion of the article with said braze alloy powder composition, wherein said brazing is done at temperatures of between about 2150°F and about 2350°F.
 - 13. The method of claim 12 and further comprising the step of exposing the brazed article to a stepped diffusion cycle at temperatures of between about 1900°F and about 2100°F.
- 10 14. The method of claim 12 wherein said providing step comprises providing a braze alloy powder composition comprising about 45% of at least one low-melt alloy powder and about 55% of at least one high-melt alloy powder, wherein said at least one low-melt alloy powder comprises a mixture of three lowmelt alloy powders, including: (a) about 35% of a first low-melt powder 15 comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third lowmelt powder comprising about 64% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B, and about 20 55% of a high-melt alloy powder comprising about 58% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, 2-4% Re, 1-2% Hf, and about 5% W.
 - 15. The method of claim 14 and further including the step of exposing the brazed article to a stepped diffusion cycle as follows:
 - a. Heat part to 1800-2000°F and hold for 0.5-4 hours;
 - b. Heat part to 1900-2100°F and hold for 1-4 hours;
 - c. Heat part to 1950-2150°F and hold for 1-4 hours;
 - d. Heat part to 2000-2200°F and hold for 6 to 24 hours; and
 - e. Cool to ambient temperature.
- 16. The method of claim 15 wherein the heating is preferably
 30 accomplished at a rate such that the first heating step is performed at a rate of
 about 20-40°F per minute, the second heating step is performed at a rate of about
 10-30°F per minute, the third heating step is performed at a rate of about 5-20°F

per minute, the fourth heating step is performed at a rate of about 5-20°F per minute.

17. The method of claim 15 wherein said stepped diffusion cycles is as

follows:

a. Heat to 1900°F at 30°F per minute and hold for 1 hour;


5

- b. Heat to 2000°F at 20°F per minute and hold for 2 hours;
- c. Heat to 2050°F at 10°F per minute and hold for 2 hours;
- d. Heat to 2100°F at 10°F per minute and hold for 8 to 18

hours;

e. Cool at a rate effective to avoid thermal distortion.

BNSDOCID: <WO_____0250323A2_I_>

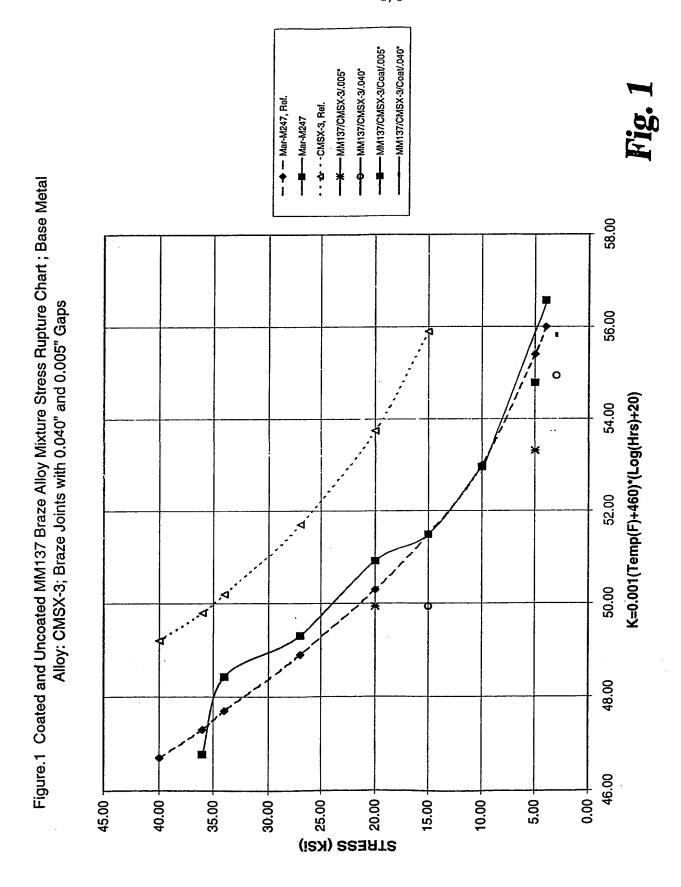



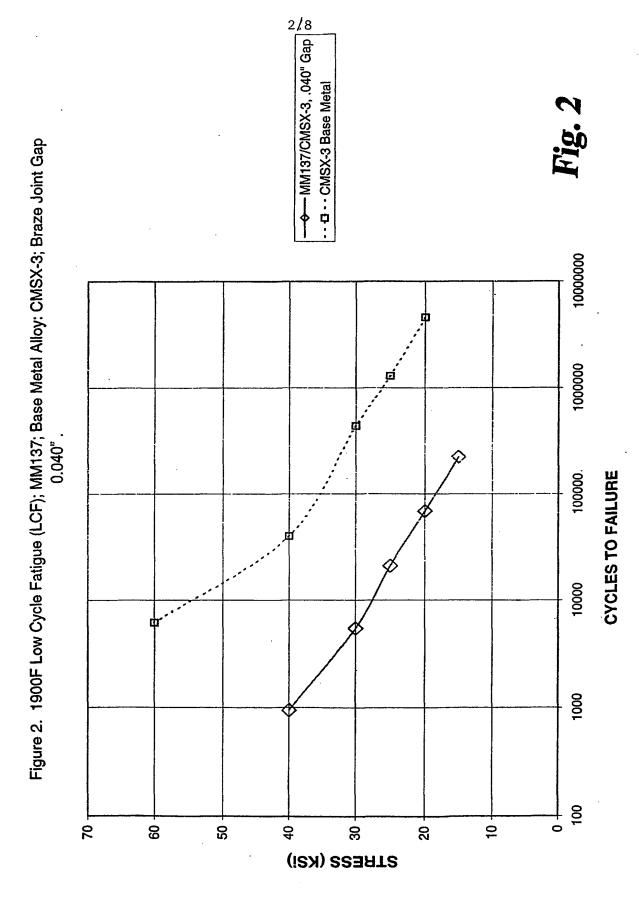


Fig. 3

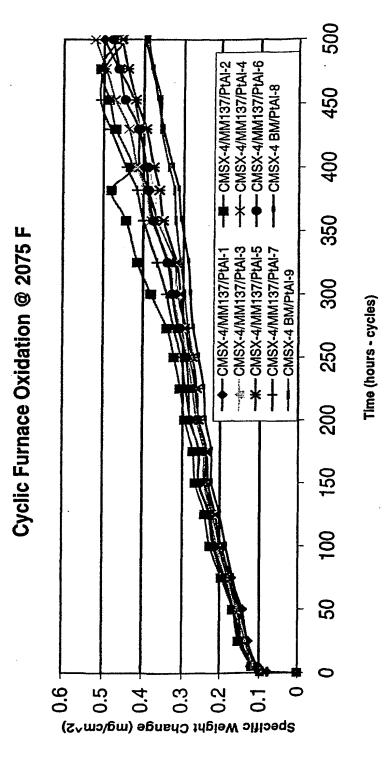

BNSDOCID: <WO_____0250323A2_I_>

FIG. 4A

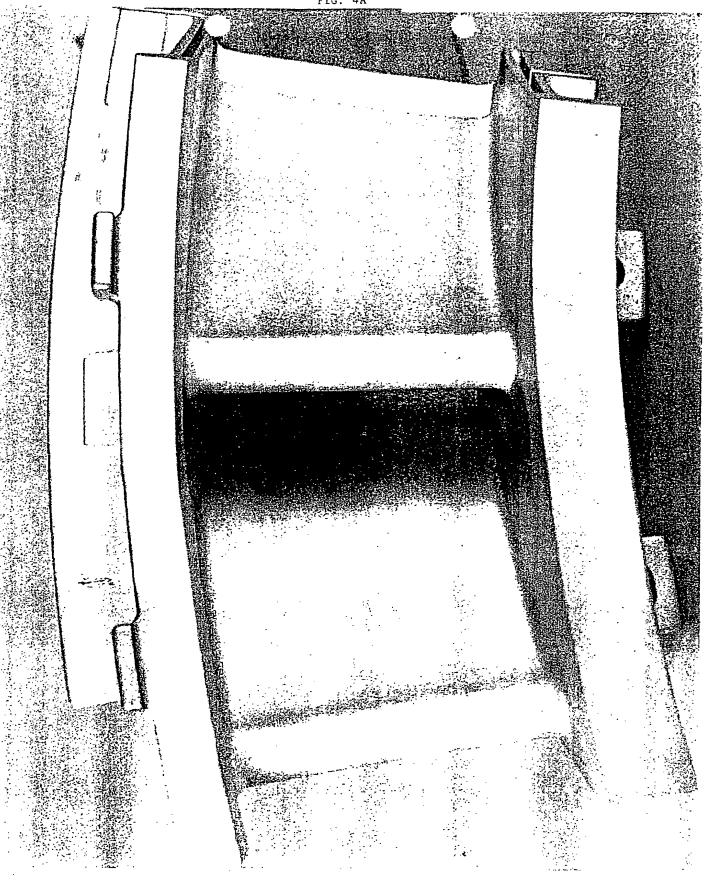


5/8

FIG. 4B




6/8

FIG. 4C

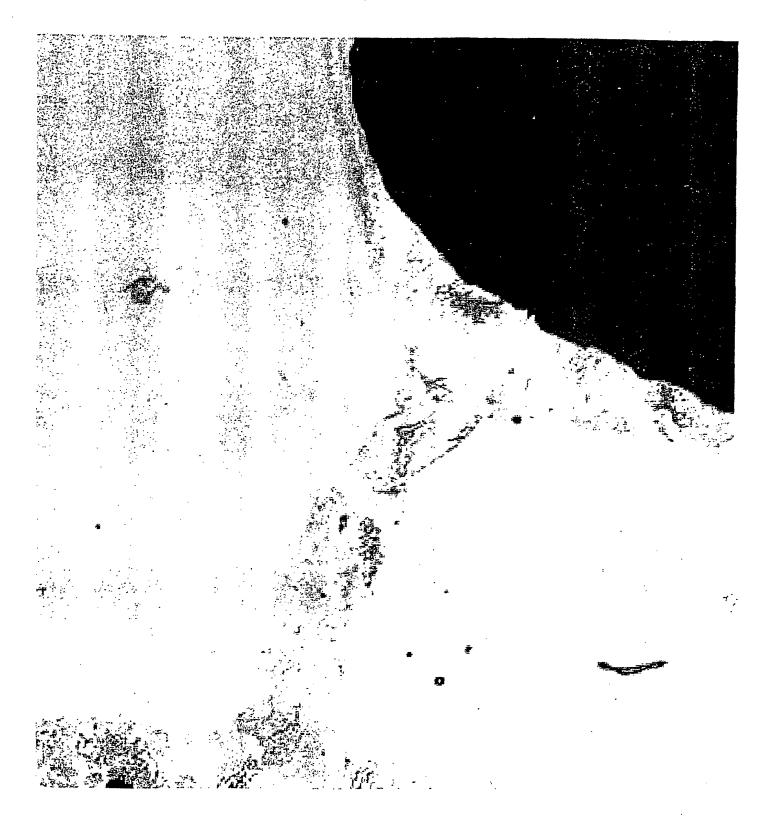

Diffusion Braze Repair of Vanes

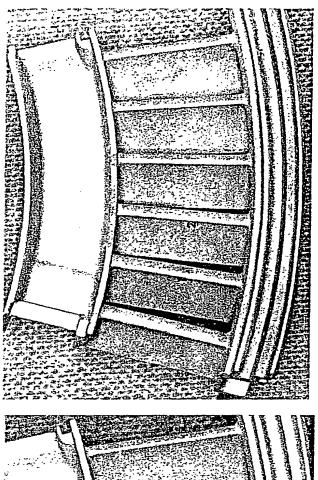

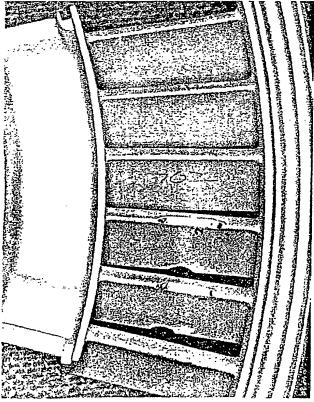
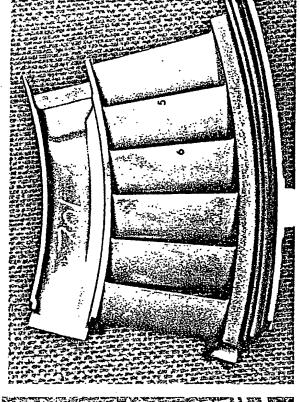


Fig. 5a Leading edge sides of vane segment prior to and after braze repair.

8/8

Diffusion Braze Repair of Vane



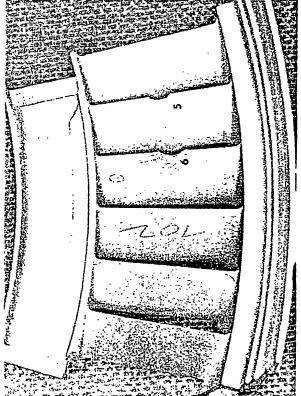


Fig. 5b Trailing edge sides of vane segment prior to and after braze repair.

(19) World Intellectual Property Organization International Bureau



. 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 1881 - 188

(43) International Publication Date 27 June 2002 (27.06.2002)

PCT

(10) International Publication Number WO 02/050323 A3

(51) International Patent Classification⁷: C22C 19/05

B23K 31/02,

(21) International Application Number: PCT/US01/47838

(22) International Filing Date:

10 December 2001 (10.12.2001)

(25) Filing Language:

English

(26) Publication Language:

English

(30) Priority Data:

09/737,901

15 December 2000 (15.12.2000) U

(71) Applicant (for all designated States except US): ROLLS-ROYCE CORPORATION [US/US]; P.O. Box 420, Indianapolis, IN 46206-0420 (US).

(72) Inventors; and

(75) Inventors/Applicants (for US only): CHESNES, Richard, P. [US/US]; 11994 Carrington Court, Cincinnati, OH 45249 (US). XU, Raymond, Ruiwen [US/US]; 1603 Springmill Boulevard, Carmel, IN 46032 (US).

(74) Agents: THOMAS, Timothy, N. et al.; Woodard, Emhardt, Naughton, Moriarty & McNett, Suite 3700, Bank One Center/Tower, 111 Monument Circle, Indianapolis, IN 46204 (US). (81) Designated States (national): AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TR, TT, TZ, UA, UG, US, UZ, VN, YU, ZA, ZM, ZW.

(84) Designated States (regional): ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, CH, CY, DE, DK, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG).

Published:

with international search report

(88) Date of publication of the international search report: 6 September 2002

For two-letter codes and other abbreviations, refer to the "Guidance Notes on Codes and Abbreviations" appearing at the beginning of each regular issue of the PCT Gazette.

V

(54) Title: NICKEL DIFFUSION BRAZE ALLOY AND METHOD FOR REPAIR OF SUPERALLOYS

(57) Abstract: A braze alloy powder mixture that includes a low-melt powder composition and a high-melt powder composition. The low-melt powder composition is made of one or more low-melt powders and includes 50-70 % Ni, 8-20 % Cr, 8-15 % Ta, 4-10 % Co, 2-7 % Al, and up to 2.25 % B. The high-melt powder composition is made of one or more high-melt powders and includes 50-70 % Ni, 2-10 % Cr, 2-10 % Ta, 5-15 % Co, 2-10 % Al, 2-10 % W, and up to about 3 % each of Re, Mo and Hf. Up to about 1 % Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and/or Zr may be included in the low-melt powder, while the high-melt powder may include up to about 1 % each of Ti, Nb, C, B, Si, and Zr.

INTERNATIONAL SEARCH REPORT

International application No. PCT/US01/47838

A. CLASSIFICATION OF SUBJECT MATTER . IPC(7) :B23K 31/02; C22C 19/05										
Electronic data base consulted during the international s	search (name of data base and, where practicable	, search terms used)								
C. DOCUMENTS CONSIDERED TO BE RELEV	ANT									
Category* Citation of document, with indication, w	where appropriate, of the relevant passages	Relevant to claim No.								
	et al.) 31 August 1993, see entire	9-11								
A document.		1-8, 12-17								
A US 4,381,944 A (SMITH JR, document.	et al.) 03 May 1983, see entire	1-17								
A US 4,830,934 A (FERRIGNO document.	et al.) 16 May 1989, see entire	1-17								
Further documents are listed in the continuation	of Box C. See patent family annex.									
Special categories of cited documents: "A" document defining the general state of the art which considered to be of particular relevance "E" earlier document published on or after the international fill document which may throw doubts on priority claim(s) or cited to establish the publication date of another citation special reason (as specified) "O" document referring to an oral disclosure, use, exhibition means "P" document published prior to the international filing date than the priority date claimed	which is or other document of particular relevance; the considered to involve an inventive combined with one or more other such being obvious to a person skilled in	lication but cited to understand the invention cannot be the claimed invention cannot be the claimed invention cannot be the claimed invention cannot be the the document is the documents, such combination the art								
Date of the actual completion of the international search		earch report								
21 MAY 2002	12 JUN 2002									
Name and mailing address of the ISA/US Commissioner of Patents and Trademarks Box PCT Washington, D.C. 20231 Facsimile No. (703) 305-3230	Authorized officer GEORGE WYSZOMIERSKI Telephone No. (703) 308-2531	Buf (Weil)								

Form PCT/ISA/210 (second sheet) (July 1998)★

CORRECTED VERSION

(19) World Intellectual Property Organization International Bureau



(43) International Publication Date 27 June 2002 (27.06.2002)

PCT

(10) International Publication Number WO 02/050323 A3

- (51) International Patent Classification⁷: B23K 31/02, C22C 19/05
- (21) International Application Number: PCT/US01/47838
- (22) International Filing Date:

10 December 2001 (10.12.2001)

(25) Filing Language:

English

(26) Publication Language:

English

(30) Priority Data:

09/737,901

15 December 2000 (15.12.2000) US

- (71) Applicant (for all designated States except US): ROLLS-ROYCE CORPORATION [US/US]; P.O. Box 420, Indianapolis, IN 46206-0420 (US).
- (72) Inventors; and
- (75) Inventors/Applicants (for US only): CHESNES, Richard, P. [US/US]; 11994 Carrington Court, Cincinnati, OH 45249 (US). XU, Raymond, Ruiwen [US/US]; 1603 Springmill Boulevard, Carmel, IN 46032 (US).
- (74) Agents: THOMAS, Timothy, N. et al.; Woodard, Emhardt, Naughton, Moriarty & McNett, Suite 3700, Bank One Center/Tower, 111 Monument Circle, Indianapolis, IN 46204 (US).

- (81) Designated States (national): AE, AG, AL, AM, AT, AU, AZ, BA, BB, BG, BR, BY, BZ, CA, CH, CN, CO, CR, CU, CZ, DE, DK, DM, DZ, EC, EE, ES, FI, GB, GD, GE, GH, GM, HR, HU, ID, IL, IN, IS, JP, KE, KG, KP, KR, KZ, LC, LK, LR, LS, LT, LU, LV, MA, MD, MG, MK, MN, MW, MX, MZ, NO, NZ, OM, PH, PL, PT, RO, RU, SD, SE, SG, SI, SK, SL, TJ, TM, TR, TT, TZ, UA, UG, US, UZ, VN, YU, ZA, ZM, ZW.
- (84) Designated States (regional): ARIPO patent (GH, GM, KE, LS, MW, MZ, SD, SL, SZ, TZ, UG, ZM, ZW), Eurasian patent (AM, AZ, BY, KG, KZ, MD, RU, TJ, TM), European patent (AT, BE, CH, CY, DE, DK, ES, FI, FR, GB, GR, IE, IT, LU, MC, NL, PT, SE, TR), OAPI patent (BF, BJ, CF, CG, CI, CM, GA, GN, GQ, GW, ML, MR, NE, SN, TD, TG).

Published:

- with international search report
- (88) Date of publication of the international search report:
 6 September 2002
- (48) Date of publication of this corrected version:

17 April 2003

(15) Information about Correction:

see PCT Gazette No. 16/2003 of 17 April 2003, Section II

For two-letter codes and other abbreviations, refer to the "Guidance Notes on Codes and Abbreviations" appearing at the beginning of each regular issue of the PCT Gazette.

23

(54) Title: NICKEL DIFFUSION BRAZE ALLOY AND METHOD FOR REPAIR OF SUPERALLOYS

(57) Abstract: A braze alloy powder mixture that includes a low-melt powder composition and a high-melt powder composition. The low-melt powder composition is made of one or more low-melt powders and includes 50-70 % Ni, 8-20 % Cr, 8-15 % Ta, 4-10 % Co, 2-7 % Al, and up to 2.25 % B. The high-melt powder composition is made of one or more high-melt powders and includes 50-70 % Ni, 2-10 % Cr, 2-10 % Ta, 5-15 % Co, 2-10 % Al, 2-10 % W, and up to about 3 % each of Re, Mo and Hf. Up to about 1 % Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and/or Zr may be included in the low-melt powder, while the high-melt powder may include up to about 1 % each of Ti, Nb, C, B, Si, and Zr.



WO 02/050323 PCT/US01/47838

5

10

15

20

25

30

35

NICKEL DIFFUSION BRAZE ALLOY AND METHOD FOR REPAIR OF SUPERALLOYS

The present invention relates generally to compositions and methods for repairing superalloys, and more particularly to compositions and methods for the braze repair of nickel- and/or cobalt-based superalloy parts.

BACKGROUND OF THE INVENTION

Nickel- and/or cobalt-based superalloys are commonly used by the aerospace and power industries for components such as turbine vanes that will be subjected to high temperatures and stress. While such alloys are inherently strong and resistant to damage, cracks and ruptures occasionally occur. When the damage is relatively minor, repairs can be made, such as, for example, by braze repair.

High temperature diffusion braze technology is normally used to repair turbine vanes made of Ni- and Co-based superalloys. The braze alloy mixture typically includes two powdered constituents. The first constituent (the base metal powder) is a high temperature powder with a chemistry the same as, or similar to, the component being repaired. The second constituent (the braze alloy powder) consists of a high temperature diffusion braze alloy that has a melting temperature well below that of the base metal powder. This braze alloy powder is used to join the base metal powder particles together, and to join the composite powder mixture to the areas of the component being repaired.

Diffusion braze alloy powders typically contain melting point depressants such as boron and/or silicon of elements. Unfortunately though, the use of boron and silicon in braze alloys can have a negative impact on the mechanical and/or environmental properties of the repaired area of the part. In particular, large, blocky or script-like brittle phases are formed which decrease the ability of the material to resist rupture from stress. These brittle phases are composed of refractory elements, chromium, and/or titanium combined with boron, silicon and carbon. For the braze repair of directional solidified (DS) superalloys with

BNSDOCID: <WO____0250323A3_IA>

columnar-grained (CG) and single-crystal (SC) microstructure, B and Si are particularly detrimental to the mechanical properties and oxidation resistance.

A need therefore exists for improved braze repair alloy powders with minimal amounts of B and/or Si, that can be used for repairing superalloys such as those found in jet engine turbine vanes. The present invention addresses that need.

BNSDOCID: <WO_____0250323A3_IA>

SUMMARY OF THE INVENTION

Briefly describing one aspect of the present invention, there is provided a braze alloy powder mixture comprising a low-melt powder composition and a high-melt powder composition. The low-melt powder composition may be made from a single low-melt alloy powder, or it may be a mixture of more than one low-melt alloy powder. In either event, the low-melt powder composition preferably comprises, by weight, 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to about 2.25% B. Similarly, the high-melt powder composition may be made from a single high-melt alloy powder, or it may be a mixture of more than one high-melt alloy powder. In either event, the high-melt powder composition preferably comprises, by weight, 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, and up to about 3% each Re, Mo and/or Hf.

In the most preferred embodiments the low-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and Zr, and the high-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, Nb, C, B, Si, and Zr.

Accordingly, the braze alloy mixture (that is, the combination of low-melt and high-melt powders) preferably comprises 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-7% Al, 2-4% W, about 1-2% Re, and about 0.5-1% each of Mo and Hf. In the most preferred embodiments the braze alloy mixture also comprises up to about 1% each of any or all of the following: Ti, Nb, Pd, Pt, Ir, Ru, C, B, Si, and Zr.

One object of the present invention is to provide braze alloy powders useful for the braze repair of Ni- and/or Co-based superalloys.

Other objects and advantages will be apparent from the following description.

BNSDOCID: <WO_____0250323A3_IA>

5

10

15

BRIEF DESCRIPTION OF THE DRAWINGS

- FIG. 1 is a graph showing the results of a stress rupture test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.
 - FIG. 2 is a graph showing the results of a low cycle fatigue test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.

10

5

- FIG. 3 is a graph showing the specific weight change during a cyclic furnace oxidation test performed on an article repaired with the inventive braze repair alloy powders of one preferred embodiment of the present invention.
- FIG. 4A shows an engine vane segment with fine cracks in the vane.
 - FIGS. 4B and 4C show cracks in an engine vane segment such as that shown in FIG. 4A, after repair with the inventive braze repair alloy powders of the present invention.

20

FIGS. 5A and 5B show leading and trailing edge sides of a vane segment prior to (5A) and after (5B) braze repair using the inventive braze repair alloy powders of the present invention.

DESCRIPTION OF THE PREFERRED EMBODIMENTS

For the purposes of promoting an understanding of the principles of the invention, reference will now be made to certain preferred embodiments and specific language will be used to describe the same. It will nevertheless be understood that no limitation of the scope of the invention is thereby intended, such alterations and further modifications in the illustrated device, and such further applications of the principles of the invention as illustrated therein being contemplated as would normally occur to one skilled in the art to which the invention relates.

As indicated above, one aspect of the present invention relates to powders useful for the braze repair of superalloy components such as turbine vanes. In a preferred embodiment one or more low-melt alloy powders is mixed with one or more high-melt alloy powders to form a powdered braze alloy mixture that can be used for the repair.

Another aspect of the invention relates to methods of repairing superalloy components by using the subject braze alloy mixtures at braze temperatures of about 2300°F, followed by a stepped, diffusion heat treatment cycle at temperatures ranging from about 1900°F to about 2100°F.

1. Substrates.

The braze repair compositions and methods of the present invention can be used to repair a wide variety of substrates, including nickel- or cobalt-based alloy substrates. Specific examples of alloys that can be repaired with the compositions and methods of the present invention include, but are not limited to: nickel-based alloys such as Mar-M246, Mar-M247; single crystal nickel alloys such as CMSX-3, CMSX-4, and CM-186; and cobalt-based alloys such as Mar-M509 and X40.

2. Braze Alloy Powders, and Mixtures Thereof.

The braze alloy powder mixtures of the present invention include both a low-melt powder composition and a high-melt powder composition. The low-melt alloy powder composition is an alloy, or a mixture of alloys, that substantially melts below the braze temperature (hence the name "low-melt"). In contrast, the high-melt alloy powder composition is an alloy, or a mixture of alloys, that remains substantially unmelted at braze temperatures because the

BNSDOCID: <WO_____0250323A3_IA>

5

10

15

20

25

10

15

20

25

30

composition has a melting temperature <u>above</u> the braze temperature (hence the name "high-melt").

In the preferred embodiments of braze repair mixtures used to repair Ni-based superalloys such as MAR-M247 or CMSX-3, the low-melt powder composition is preferably made from a mixture of alloys that melt below about 2250°F, with the combination of alloys being selected so that the low-melt powder composition as a whole substantially melts in the range of about 2100°F +/- 100°F. The high-melt alloy powder composition used in such embodiments is preferably made of a single high-melt alloy that doesn't melt until it gets above about 2400°F.

In the most preferred embodiments the low-melt powder composition accordingly comprises one or more alloy powders and has a resulting composition of about 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to about 2.25% B and/or Si, by weight, and has a compositional melting range of between about 2000°F and 2250°F. In certain preferred embodiments the low-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, and Zr.

Most preferably, the alloys used to prepare the low-melt alloy powders each contain between about 0.65 and about 2.25% B, with the total amount of B in the low-melt powder composition preferably being between about 1% and 2%. The low-melt alloy powders each also preferably contain up to about 3% Si, with the total amount of Si in the low-melt powder preferably being between about 0.5% and 1%.

The high-melt powder composition preferably is an alloy (or mixture of alloys) with a chemistry that is the same or substantially the same as the alloy in the substrate to be repaired. Accordingly, to repair Ni-based superalloy components such as those made of MAR-M246 or 247, or CMSX-3 or -4, the high-melt powder composition typically comprises about 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, 2-4% Re, and up to about 3% each of Mo and Hf. In the most preferred embodiments the high-melt powder composition also comprises up to about 1% each of any or all of the following: Ti, Nb, C, B, Si, and Zr.

10

15

20

25

30

The low-melt alloy composition and the high-melt alloy composition are generally combined at ratios of about 1:3 to about 3:1 low-melt:high-melt powder, with ratios of 1:2 to 2:1 being more preferred. In the most preferred embodiments, the ratio of low-melt powder to high-melt powder is typically in the range of 1:1 to 1:1.5.

In testing to date, compositions comprising about 40-50% low-melt alloy powder, and about 50-60% high-melt powder has been preferred for repairing Ni-based superalloy parts such as vanes made of CMSX-3. A ratio of about 45:55 low-melt:high-melt powders has been most preferred for those Ni-based superalloy repairs.

In selecting the proportions of components used in the invention, it should be recognized that higher weight percentages of high-melt powder typically provide better mechanical properties in view of their reduced levels of boron and/or silicon. Similarly, higher percentages of low-melt powders typically have improved braze flow. As can be appreciated by persons skilled in the art, a proper balance between mechanical properties and braze flow must be established, as dictated by the demands of a particular application.

Higher Al content is also desired in some embodiments because Al-rich compositions improve high-temperature oxidation properties. Further, increasing the Ta content in the mixtures improves the braze joint mechanical properties. In particular, Ta additions strengthen the gamma and gamma prime phases by increasing lattice mismatches.

In view of the above, it can be seen that the final braze alloy repair mixture preferably comprises 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-7% Al, 2-4% W, 1-2% Re, and about 1% each of Mo and Hf, and most preferably also comprises up to about 1% each of any or all of the following: Ti, Nb, Pd, Pt, Ir, Ru, C, B, Si, and Zr.

As indicated above, in certain preferred embodiments the low-melt alloy powder comprises a mixture of two or more low-melt alloys. In one preferred embodiment particularly useful for repairing Ni-based superalloy parts, the low-melt alloy powder comprises: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B, with a

liquidus temperature of about 2050°F; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B, with a liquidus temperature of about 2250°F; and (c) about 20% of a third low-melt powder comprising about 64% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B, with a liquidus temperature of about 2000°F.

In one preferred embodiment the high-melt powder composition comprises about 55-60% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.

Table 1 below shows the compositions, by weight %, of three potential low-melt alloys (ADB-01, ADB-02, and ADB-03) and one potential high-melt alloy (HMA-01). In the most preferred embodiments these alloys are combined such that the low-melt alloy powder comprises about 35% ADB-01, about 45% ADB-02, and about 20% ADB-03. One preferred braze repair powder comprises 45% of this mixture of low-melt powders, and 55% of this preferred high-melt powder.

Table 2 below shows other low-melt and high-melt alloy powders that may be used in the present invention. (It is to be appreciated that Table 2 is for illustrative purposes, and that not all low-melt or high-melt powders are shown in Table 2.) Table 3 shows braze repair alloy mixtures of those low-melt and high-melt alloy powders. (It is also to be appreciated that Table 3 is for illustrative purposes, and that not all mixtures of low-melt and high-melt powders are shown in Table 3.)

5

10

15

Table 1, BRZAE ALLOY COMPOSITIONS by weight percent

¥	.01 гаах	жи 10.	.005 max	.30 max							
Pd	хат 10,	.01 max	жи 500.			z	.0300 max	.0300 max	.0300 max		
25	.05 max	.05 max	2.75-3.25	.06 шах		Mg	.01 max	.01 max	Xem 10.	.0035тах	
æ	2.00-2.25	.85-1.15	1.20-1.40	.0102		ತ	.l max	.l max	.1 max	.l max	
C	**.02 max	**.02 max	** .02 max	.1014		٨	.l max	.l max	.l max	.2 тах	
Ħ	.01 max	.01 max	0,40-0.60	1.30-1.70		Fe	.l max	.1 max	.l mux	.1 max	-
£	.01 max	.01 max	1.00-1.50	0.10mux		Ы	xam 210.	.015 тах	.015 max	.010 max	
Ta	.01 max	25.8-26.2	4.00-4.50	6.20-6.50		S	жет 0100.	хиш 0100.	.0002 max	.0040 тах	
Re	xam 10.	.01 max	1.00-1.50	2.60-3.00		0	#.0300 max	#.0300 max	.0100 max	#.0300 max	
Mo	.01 max	.01 max	.01 max	1.30-1.70		Mn	.01 max	.01 тах	.01 max	.01 max	
W	,01 max	.01 max	3.25-3.75	4.70-5.10		***Ce	.005 max	.005 max	.005 max		
င	11.25-12.25	.05 max	7.75-8.25	11.45-12.05		La	.005 тах	хат 200.	.005 пах		
TI	.01 max	.01 max	.01 max	0.02max		Y	.005 max	.005 тах	.005 плах		
Al	6.15-6.35	.01 тах	6.15-6.35	5.94-6,30		Ru	.01 max	.01 тах	.01 max		
ò	5.75-6.25	30.8-31.2	5.9-6.10	00'1-09'9		ır	.01 max	XIII 10.	.01 max		
Z	BAL.	BAL.	BAL.	BAL.		Z	.01 тах	хли 10.	жт 500.	.030 тах	
Alloy	10-8QY	ADB-02	ADB-03	HMA-01		Alloy	ADB-01	ADB-02	ADB-03	HMA-01	

TABLE 2, BRZAE ALLOY COMPOSITIONS by weight percent

_	П	_			_			r	Γ.					_	_	Г	T-	<u> </u>	Г	Γ-	_				П	_								Γ-	Γ	Ι-	Г	Т
27		.005 max	.005 mex	.005 max	.005 max	.005 глах	.01 max	.01 max	.01 max	.01 max	.005 mex	.005 max	.005 max																					_				
σ		5.0-5.5	3.0-3.5	6.5-6.0	3.25-3.75	.05 max	.05 max	.05 max	.05 max	.05 max	.05 max	2.75-3.25	.05 max	0.015																								
8		.45-55	1.0-1.25	.4555	1.20-1.50	2.40-2.60	2.00-2.25	.01 max	.85-1.15	1.60-1.80	.01 max	1.20-1.40	.01 max	3		on Edditions										-												
ပ		.0812	.01 mex	.0812	.04-08	**.02.max	*,02 max	••.02 тах	**.02 max	*.02 max	.0204	** .02 max	102-04	0.062		" With no carbon edditions																						
ΡE		.01 max	.01 mex	.01 max	.01 max	.01 max	.01 max	.01 тах	.01 max	.01 тах	.01 max	.01 max	.Ot max																									
1		.01 шах	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max					- -																				
æ		.005 max	25.75	.005 max	.005 max	.005 max	.01 max	.01 max	.01 max	.01 max	.005 max	.005 max	.01 max																									
g.		2.75-3.25	.25.75	.005 max	5.75-8.25	25-75	.01 max	.01 max	.01 max	.01 max	.01 max	.005 max	59.5-60.5							z		.0300 max	.0300 max	.0300 max	.0300 тах	.0300 шах	.0300 max	.0300 max	.0300 тах	.0300 max	.0300 max	.0300 max	.0300 max					
Ŧ		.1 mex	.01 max	.01 max	0.8-12	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	0.40-0.60	.01 max							SE SE		.01 max	.01 max	от тех	жеш 10.	.01 max	жш 10.	.01 так	.01 max	.01 max	.01 max	.01 max	.01 max					
₽.		.tomax	94-	.10 тах	.10 max	.10 mgx	.01 max	.01 max	жеш 10.	.01 max	.01 max	1.00-1.50	.01 max	2						3		.1 max	.t max	тах .	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max	.1 mex	.1 max					
Te		7.75-8.25	9.75-10.25	10.75-11.25	10.75-11.25	6.25-6.50	.O1 mex	.01 max	25.8-26.2	29.8-30.2	6.25-6.50	4.00-4.50	.01 max	7						>		.1 max	.1 max	.1 mex	.1 max	.1 max	.1 mex	.1 max	,1 max									
å	1	.01 max	0.3-0.5	.01 max	.01 max	.01 тах	.01 max	.01 max	.01 max	.01 тах	.01 max	1.00-1.50	.01 max							æ		.1 max	.1 max	.1 тах	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max	.1 max					
No	Ī	.01 max	.01 max	.01 max	.01 тах	.01 max	.01 max	.01 max	.01 max	.01 max	.01 max	.01 тах	.01 max	2			!	:		a		.015 max	.015 тах	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max	.015 max					
*		1.75-2.25	1.0-1.5	1.75-2.25	1.25-1.75	.01 шах	.01 max	.01 max	.01 max	.01 max	.01 max	3.25-3.76	.01 max	7						s		.0002 max	.0002 max	.0002 max	.0002 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	# .0010 max	.0002 max	#.0010 max					
ន		10.75-11.25	_	-	-	11.25-12.25	11.25-12.25	.05 max	.05 тах	BAL.	11.25-12.25	7.75-8.25		9						0		.0100 max	.0100 max	.0100 max	.0100 max	€.0300 max 8 .0010 max	6,0300 max # ,0010 max	#.0300 max #.0010 max	#.0300 mex	#.0300 max #.0010 max	#.0300 max # .0010 max	.0100 max	#.0300 max # .0010 max					
F	1	.01 max	.01 тах		.Of max	_	.01 mex	.01 max	.01 max	.01 max	.01 max	.01 max	_							¥		.01 max	.01 тах	.01 mex	.01 max				.01 max	.01 mex	.01 max	.01 тах	.О1 тах					
7		4.75-5.25	4.75-5.25	4.75-5.25	4.75-5.25	6.15-6.35	6.15-6.35	54.75-55.25	.01 тах	.01 max	6.15-6.35	6.15-6.35	.01 max	9						9 7		.005 max	.005 max	.005 max	.005 max	.005 max	.005 max	.005 max										
ŏ		6.75-7.25	6.25-6.75	6.25-6.75	6.25-6.75	6.25-6.75	5.75-6.25	.01 max	30.8-31.2	.01 max	625-6.75	5.9-6.10	.01 max							5		.005 max	.005 max	.005 max	.005 тах	.005 тах	.005 max	.005 max	.005 тах	.005 max	.005 тах	.005 max						
Z		BAL.	BAL.	BAL	BAL.	BAL	BAL.	BAL	BAL	.05 max	BAL	BAL.	TWB	BAL						>		.005 тах	.005 mex	.005 max	.005 mex	.005 max		.005 тах		.005 max	.005 max	.005 max						
ALLOY		ADB-101	ADB-102	ADB-103	ADB-104	ADB-106	ADB-01	ADB-108	ADB-02	ADB-110	A08-111	ADB-03	ADB-114	ACT-4						ALLOY	<u></u>	ADB-101	ADB-102	ADB-103	ADB-104	ADB-106	ADB-01	ADB-108	ADB-02	ADB-110	ADB-111	ADB-03	ADB-114					

TABLE 3. BRAZE ALLOY MIXTURES AND TEST NOTES

MGT-MI247/ADB-03 50/50 MGT-MI247/ADB-03 50/50 MGT-MI247/ADB-03 (ADB-106 40/30/30 247/ADB-03/AMS/4782 40/40/20 MGT-MI247/ADB-03/ADB-104 40/30/30 MGT-MI247/ADB-03/ADB-104 40/30/30 MGT-MI247/ADB-03/ADB-104 40/30/20 MGT-MI247/ADB-03/ADB-114 50/20/20 MGT-MI247/ADB-03/ADB-114 50/40/10 MGT-MI247/ADB-03/ADB-114 50/40/10 MGT-MI247/ADB-02/ADB-114 50/40/10 MGT-MI247/ADB-02/ADB-114 50/35/10/5 MGT-MI247/ADB-02/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/30 HMA-01/ADB-01/ADB-02 60/20/30 HMA-01/ADB-01/ADB-02 60/20/30 HMA-01/ADB-01/ADB-02 60/20/30 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01 60/40 HMA-01/ADB-01 60/40 HMA-01/ADB-02 60/20/20	Mivhiro #	Allov Alivhira	Commonly
Mid-M-17/17/DB-03/ADB-106 40/30/30 Mid-M-27/17/ADB-03/ADB-106 40/30/30 247/ADB-03/AMS-782 40/40/20 Mid-M247/ADB-03/ADB-104 40/30/30 Mid-M247/ADB-03/ADB-104 40/30/20 Mid-M247/ADB-03/ADB-114 60/20/20 Mid-M247/ADB-03/ADB-114 60/20/20 Mid-M247/ADB-03/ADB-114 60/20/20 Mid-M247/ADB-03/ADB-114 50/40/10 Mid-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mid-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mid-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mid-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mid-M247/ADB-02/ADB-03 50/20/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-02/ADB-03 50/20/20 HMA-01/ADB-02/ADB-03 50/20/20 HMA-01/ADB-02 50/20/20	MM-20	_ا	Alloy densified Right ships sliver surface Good wet-out 100% slot fill
MGT-MZ4/JADB-03/ADB-103/03030 MGT-MZ4/JADB-03/ADB-104 40/30/30 MGT-MZ4/JADB-03/ADB-104 40/30/30 MGT-MZ4/JADB-03/ADB-104 40/30/30 MGT-MZ4/JADB-03/ADB-114 50/20/20 MGT-MZ4/JADB-03/ADB-114 50/20/10 MGT-MZ4/JADB-02/ADB-114 50/30/10 MGT-MZ4/JADB-02/ADB-114 50/30/10 MGT-MZ4/JADB-02/ADB-114 50/30/10 MGT-MZ4/JADB-02/ADB-114 50/30/10 MGT-MZ4/JADB-02/ADB-03 50/40/10 MGT-MZ4/JADB-02/ADB-03 50/40/10 MGT-MZ4/JADB-02/ADB-03 50/40/10 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	75 Januar	CONTRACTOR OF THE PROPERTY OF	Calcy definition. Digital surfaces decod well-dut. 1000 such file.
247/ADB-03/AMS4782 40/40/20 Mor-M247/ADB-03/ADB-104 40/30/30 Mor-M247/ADB-03/ADB-104 40/30/30 Mor-M247/ADB-03 40/60 Mor-M247/ADB-03 40/60 Mor-M247/ADB-03/ADB-114 60/20/20 Mor-M247/ADB-02/ADB-114 50/36/10/5 Mor-M247/ADB-02/ADB-114 50/36/10/5 Mor-M247/ADB-02/ADB-03 50/40/10 Mor-M247/ADB-02/ADB-03 50/40/10 Mor-M247/ADB-02/ADB-03 50/40/10 Mor-M247/ADB-07/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-03 60/20/10 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20	MM-30	MOT-WIZ47/AUB-US/AUB-100 4U/3U/3U	Alloy densined. Bright shiny silver surface. Good wet-out. 100% slot fill.
Mog-M247/ADB-03/ADB-104 40/30/30 Mog-M247/ADB-03/ADB-104 20/20/30/30 Mog-M247/SXCX-4/ADB-03/ADB-104 20/20/30/30 Mog-M247/ADB-03/ADB-114 60/20/20 Mog-M247/ADB-03/ADB-114 40/35/25 Mog-M247/ADB-02/ADB-114 40/35/25 Mog-M247/ADB-02/ADB-114 50/40/10 Mog-M247/ADB-02/ADB-114 50/40/10 Mog-M247/ADB-02/ADB-114 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-03 50/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60	MM-37	247/ADB-03/AMS4782 40/40/20	Alloy densified. Bright shiny silver surface. Good wet-out, 100% slot fill.
Mag-W247/SXCX-4/ADB-03/ADB-104 20/20/30/30 MAR-W247/ADB-03 40/60 Mac-W247/ADB-03/ADB-114 40/35/25 Mac-W247/ADB-03/ADB-114 40/35/25 Mac-W247/ADB-02/ADB-114 40/35/25 Mac-W247/ADB-02/ADB-114 50/40/10 Mac-W247/ADB-02/ADB-114 50/40/10 Mac-W247/ADB-02/ADB-03 50/40/10 Mac-W247/ADB-02/ADB-03 50/40/10 Mac-W247/ADB-02/ADB-03 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/10 HMA-01/RCT-4/ADB-02 60/35/10	MM-39	Mar-M247/ADB-03/ADB-104 40/30/30	Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
MAR-M247/ADB-03 40/60 Mac-M247/ADB-03/ADB-114 60/20/20 Mac-M247/ADB-03/ADB-114 40/35/25 Mac-M247/ADB-02 40/60 Mac-M247/ADB-02 40/60 Mac-M247/ADB-02 40/60 Mac-M247/ADB-02/ADB-114 50/40/10 Mac-M247/ADB-02/ADB-114 50/35/10/5 Mac-M247/ADB-02/ADB-03 50/40/10 Mac-M247/ADB-02/ADB-03 50/40/10 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/16 HMA-01/RCT-4/ADB-02 60/35/16	MM-45	Mar-M247/SXCX-4/ADB-03/ADB-104 20/20/30/30	Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
Mog-M247/ADB-03/ADB-114 60/20/20 Mog-M247/ADB-03/ADB-114 40/35/25 Mog-M247/ADB-02 40/60 Mog-M247/ADB-02 40/60 Mog-M247/ADB-02/ADB-114 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-M247/ADB-02/ADB-03 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-47	MAR-M247/ADB-03 40/60	Alloy densified. Bright shiny silver surface. Good wet-out. 100% slot fill.
Mog-W247/ADB-03/ADB-114 40/35/25 Mog-W247/ADB-02 40/60 Mog-W247/ADB-02 40/60 Mog-W247/ADB-02/ADB-01 50/40/10 Mog-W247/ADB-02/ADB-03 50/40/10 Mog-W247/ADB-02/ADB-03 50/40/10 Mog-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-W247/ADB-02/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-02 50/20/20 HMA-01/ADB-01/ADB-03 50/20/20 HMA-01/ADB-01/ADB-03 60/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/10 HMA-01/RCT-4/ADB-03 60/35/10	MM-51	Mar-M247/ADB-03/ADB-114 60/20/20	Less slot fill than MM-50.
Mog-M247/ADB-02 40/60 Mog-M247/ADB-02/ADB-114 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03 50/40/10 Mog-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mog-M247/ADB-02/ADB-03 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-52	Mar-M247/ADB-03/ADB-114 40/35/25	Alloy densified. Bright shiny silver surface. Excellent wet-out, 100% slot fill.
Mag-W247/ADB-02/ADB-114 50/40/10 Mag-W247/ADB-02/ADB-03 50/40/10 Mag-W247/ADB-02/ADB-03 50/40/10 Mag-W247/ADB-02/B-28 50/40/10 Mag-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mag-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mag-W247/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/16 HMA-01/RCT-4/ADB-02 60/35/16	MM-69	Mar-M247/ADB-02 40/60	Excellent flow and complete slot fill.
Mag-W247/ADB-02/ADB-03 50/40/10 Mag-W247/ADB-02/B-28 50/40/10 Mag-W247/ADB-02/B-28 50/40/10 Mag-W247/ADB-02/B-28/ADB-114 50/35/10/5 Mag-W247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mag-W247/ADB-02/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 50/25/15 HMA-01/ADB-01/ADB-03 50/25/15 HMA-01/ADB-01/ADB-03 50/25/15 HMA-01/ADB-01/ADB-03 50/25/15 HMA-01/ADB-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/16 HMA-01/RCT-4/ADB-02 60/35/16	MM-70	Mar-M247/ADB-02/ADB-114 50/40/10	Excellent flow and complete slot fill.
Mag-M247/ADB-02/B-28 60/40/10 Mag-M247/ADB-02/B-28/ADB-114 50/35/10/5 Mag-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mag-M247/ADB-02/ADB-03/ADB-114 50/35/10/5 Mag-M247/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-01/ADB-03 60/20 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/35/16 HMA-01/RCT-4/ADB-02 60/35/16	MM-72	Mar-W247/ADB-02/ADB-03 50/40/10	Excellent flow and complete slot fill,
Mog-M247/ADB-02/B-28/ADB-114 50/35/10/5 Mog-M247/ADB-02/ADB-03/ADB-114 56/35/10/5 Mog-M247/ADB-02/ADB-03/ADB-114 56/35/10/5 Mog-M247/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 50/25/15 HMA-01/ADB-01/ADB-02 50/25/15 HMA-01/ADB-01/ADB-02 50/25/15 HMA-01/ADB-01/ADB-03 50/25/15 HMA-01/ADB-01 70/30 HMA-01/ADB-03 50/40 HMA-01/ADB-03 50/40 HMA-01/ADB-03 50/40 HMA-01/ADB-03 50/40 HMA-01/ADB-03 50/30/10	MM-73	Mar-M247/ADB-02/B-28 50/40/10	Excellent flow and complete slot fill.
Mag-W247/ADB-02/ADB-03/ADB-114 56/35/10/5 Mag-W247/ADB-01/ADB-02 50/40/10 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/10 HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-03 60/20/15 HMA-01/ADB-01/ADB-03 60/20/16 HMA-01/ADB-01/ADB-03 60/20/20 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-74	Mar-M247/ADB-02/B-28/ADB-114 50/35/10/5	Excellent flow and complete slot fill,
Mog-M247/ADB-01/ADB-02 50/40/10 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-75	Mar-M247/ADB-02/ADB-03/ADB-114 50/35/10/5	Excellent flow and complete slot fil.
HMA-01/ADB-01 50/30/20 HMA-01/ADB-02 50/30/20 HMA-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-106	Mar-M247/ADB-01/ADB-02 50/40/10	Excellent flow and complete slot fill,
HMA-01/RCT-4/ADB-02 50/30/20 HMA-01/ADB-01/ADB-02 50/20/30 HMA-01/ADB-01/ADB-02 50/20/30 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10	MM-122		RX In SX-3 near braze; Excellent flow and complete slot fill.
HMA-01/ADB-01/ADB-02 60/20/30 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/20/10 HMA-01/ADB-01/ADB-02 60/10/30 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/ADB-03 60/30/10	MM-123		Excellent flow and complete slot fill.
HMA-01/ADB-01/ADB-02 60/20/20 HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/10/30 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/10 HMA-01/ADB-01/ADB-02/ADB-03 56/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10	MM-124		Excellent flow and complete slot fill.
HMA-01/ADB-01/ADB-02 60/30/10 HMA-01/ADB-01/ADB-02 60/10/30 HMA-01/ADB-01/ADB-02 65/25/10 HMA-01/ADB-01/ADB-02 65/25/15 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/20/20 HMA-01/ADB-03 60/30/10 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10	MM-127	21	Sluggish flow and complete slot fill. 5-10% volds in bead
HMA-01/ADB-01/ADB-02 60/10/30 HMA-01/ADB-01/ADB-02 65/25/10 HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/16 HMA-01/ADB-01/ADB-02/ADB-03 56/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/10 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10	MM-128		Excellent flow and complete stot fill. 100% RX in SX-3 interface.
HMA-01/ADB-01/ADB-02 65/26/10 HMA-01/ADB-01/ADB-02 60/26/16 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/16 HMA-01/ADB-01/ADB-02/ADB-03 65/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/36/10 HMA-01/RCT-4/ADB-02 60/36/10	MM-129		Sluggish flow and complete stot fill. A tot volds in bead.
HMA-01/ADB-01/ADB-02 60/25/15 HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-03 50/15/20/16 HMA-01/ADB-03/ADB-03 55/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10			Excellent flow and complete slot fill. 100% RX in SX-3 interface.
HMA-01/ADB-01 60/40 HMA-01/ADB-01 70/30 HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-03 50/15/20/16 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/40 HMA-01/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/30/10			Excellent flow and complete stot fill. 100% RX in SX-3 interface.
HMA-01/ADB-01 70/30 HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/15 HMA-01/ADB-01/ADB-02/ADB-03 55/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-12/ADB-10 60/30/10	- 1	HMA-01/ADB-01 60/40	Excellent flow and complete slot fill.
HMA-01/ADB-01/ADB-03/ADB-03 50/15/20/15 HMA-01/ADB-01/ADB-03/ADB-03 55/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-108/ADB-03 60/20/20 HMA-01/ACT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/16 HMA-01/RCT-12/ADB-110 60/30/10	- 1	HMA-01/ADB-01 70/30	Excellent flow and complete slot fill.
HMA-01/ADB-01/ADB-03/ADB-03 55/15/20/10 HMA-01/ADB-03 60/40 HMA-01/ADB-106/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/5	MM-136	HMA-01/ADB-01/ADB-02/ADB-03 50/15/20/15	Excellent flow and complete slot fill.
HMA-01/ADB-03 60/40 HMA-01/ADB-106/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/5 HMA-01/RCT-12/ADB-110 60/30/10	MM-137	HMA-01/ADB-01/ADB-02/ADB-03 55/15/20/10	Excellent flow and complete stot fill,
HMA-01/ADB-105/ADB-03 60/20/20 HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/6	MM-140	HMA-01/ADB-03 60/40	Excellent flow and complete slot fill.
HMA-01/RCT-4/ADB-02 60/20/20 HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/6 HMA-01/RCT-12/ADB-110 60/30/10	MM-141	HMA-01/ADB-106/ADB-03 60/20/20	Excellent flow and complete slot fill,
HMA-01/RCT-4/ADB-02 60/30/10 HMA-01/RCT-4/ADB-02 60/35/6 HMA-01/RCT-12/ADB-110 60/30/10	MM-142	HMA-01/RCT-4/ADB-02 60/20/20	Excellent flow and complete slot fill.
HMA-01/RCT-4/ADB-02 60/35/6 HMA-01/RCT-12/ADB-110 60/30/10	MM-143	- 1	Good flow and complete stot fill,
HMA-01/RCT-12/ADB-110 60/30/10	MM-144		Good flow and complete slot fill,
	MM-145	HMA-01/RCT-12/ADB-110 60/30/10	Excellent flow and complete slot fill.

3. Methods of Use

The following steps are typical for the braze repair processes of the present invention. It is to be appreciated that certain steps may be adjusted, or even omitted, depending on the nature of the component being repaired.

5

10

The first steps normally involve the inspection and cleaning of the component. Initially, chemical and mechanical cleaning processes are generally used to remove dirt, debris, grease, oils, and loose scale from the component. Following that, chemical stripping may be required to remove any coatings that may be present. Then, fluoride ion cleaning (FIC) may need to be used to remove complex oxides from the surface and from inside cracks. Finally, high-temperature vacuum cleaning may be required to remove residual oxides and fluoride ions from the FIC process. All of these methods are generally known to the art, and can be incorporated into the inventive process on an "as needed" basis without undue experimentation.

15

Following cleaning, the high temperature braze repair is begun. In that process, the braze repair alloy powder is made into a slurry (preferably using a binder effective to hold the powders together and to help hold the powders on the surface being repaired) and is applied to the surface. The component is then heated in a vacuum or in an inert gas to a temperature effective to melt the low-melt alloy so that the braze material fills the crack being repaired. In the preferred embodiments the braze temperature is between 2150°F and 2350°F, with braze temperatures of about 2300°F being most preferred. The braze time may vary from about 10 minutes to about 40 minutes, with braze times of about 20 to 30 minutes being most commonly used.

25

20

Following the brazing itself, the component is subjected to a diffusion heat treatment cycle to homogenize the repaired region. The diffusion heat treatment is preferably performed at temperatures 0-400°F below the braze temperature, and for times of up to about 24 hours. A vacuum or inert atmosphere is preferably used for the diffusion heat treatment.

30

In certain preferred embodiments the heat diffusion cycle is performed for a time and at temperatures effective to break down the script-like silicide phases into

fine discrete particles. The cycle also preferably is performed for a time and at temperatures effective to reduce the size and quantity of brittle boride phases.

In one preferred embodiment the diffusion cycle is a stepped heat cycle, as follows:

- 5 a. Heat part to 1800-2000°F and hold for 0.5-4 hours;
 - b. Heat part to 1900-2100°F and hold for 1-4 hours;
 - c. Heat part to 1950-2150°F and hold for 1-4 hours;
 - d. Heat part to 2000-2200°F and hold for 6 to 24 hours; and
 - e. Cool to ambient temperature.
- The heating is preferably accomplished at a rate such that the first heating step is performed at a rate of about 20-40°F per minute, the second heating step is performed at a rate of about 10-30°F per minute, the third heating step is performed at a rate of about 5-20°F per minute, the fourth heating step is performed at a rate of about 5-20°F per minute.
- In the most preferred embodiment the diffusion cycle is a stepped heat cycle, as follows:
 - a. Heat part to about 1900°F at about 30°F per minute and hold for 1 hour;
 - b. Heat part to about 2000°F at about 20°F per minute and hold for 2 hours;
 - c. Heat part to about 2050°F at about 10°F per minute and hold for 2 hours:
 - d. Heat part to about 2100°F at about 10°F per minute and hold for 8 to 18 hours;
- e. Vacuum or inert gas furnace cool to about 1200°F at a rate which is slow enough to avoid thermal distortion; and
 - f. Inert gas fan cool to about 150°F or less.

Reference will now be made to specific examples using the processes

described above. It is to be understood that the examples are provided to more completely describe preferred embodiments, and that no limitation to the scope of the invention is intended thereby.

WO 02/050323 PCT/US01/47838

14

EXAMPLE 1

Braze Alloy Repair

A braze repair alloy mixture is prepared by combining: (a) about 15% of a first low-melt alloy powder comprising 5.75-6.25% Cr, 6.15-6.35% Al, 11.25-5 12.25% Co, 2-2.25% B, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); (b) about 20% of a second low-melt alloy powder comprising 30.8-31.2% Cr, 25.8-26.2% Ta, 0.85-1.15% B, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); (c) about 10% of a third alloy powder comprising 5.9% Cr, 6.15-6.35% A1, 7.75-8.25% Co, 3.25-3.75% W, 1-1.5% Re, 4-4.5% Ta, 1-1.5% 10 Nb, 0.4-0.6% Hf, 1.2-1.4% B, 2.75-3.25% Si, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components and/or impurities); and (d) about 55% of a high-melt powder comprising 6.6-7% Cr, 5.9-6% Al, 11.4-12.1% Co, 4.7-5.1% W, 1.3-1.7% Mo, 2.6-3% Re, 6.2-6.5% Ta, 1.3-1.7% Hf, and the balance Ni (with only trace amounts (i.e., less than 0.1%) of other components 15

The braze repair alloy powder is made into a slurry using a commercially available binder, and is then applied to a clean surface of a Ni-based superalloy material and the component is heated in a vacuum to a braze temperatures of about 2300°F for about 20 minutes.

Following brazing, a stepped diffusion heat cycle is used, as follows:

- a. Heat to 1900°F at 30°F per minute and hold for 1 hour.
- b. Heat to 2000°F at 20°F per minute and hold for 2 hours.
- c. Heat to 2050°F at 10°F per minute and hold for 2 hours.
- d. Heat to 2100°F at 10°F per minute and hold for 8 to 18

hours.

and/or impurities).

20

25

- e. Cool to 1200°F at a rate effective to avoid thermal distortion, and hold for at least 5 minutes.
 - f. Cool to 150°F or less.

BNSDOCID: <WO_____0250323A3_IA>

10

15

20

25

30

EXAMPLE 2

Stress Rupture Testing

Stress rupture (S/R) tests were performed on representative base metals, and on articles repaired using a preferred embodiment of the inventive powder mixture and repair process. In one aspect of the test, base metal materials such as MAR-M247 and CMSX-3 were subjected to heat treatments corresponding to the steps used in the present invention (e.g., heating to braze temperature, followed by a typical stepped heat diffusion cycle) to test the effect of the inventive method on the base materials themselves. The test conditions for the base metal tests were 1800°F and 36 Ksi.

In another aspect of the S/R test, repaired parts were tested to determine the mechanical properties of parts repaired by the inventive process. The test conditions for repaired parts were 2000°F and 5 Ksi for parts in which a 0.005-inch gap was repaired, and 2000°F and 3 Ksi for parts in which a 0.040-inch gap was repaired.

The test results indicate that the braze repair process of the present invention does not cause any significant negative impact on the mechanical properties of the base metal, such as CMSX-3. Moreover, the repaired parts exhibited mechanical properties comparable to unrepaired superalloys such as MAR-M247.

For example, the average time to stress rupture for repaired parts that had a 0.005" gap (test at 2000°F and 5 Ksi) was 46.98 hours for uncoated parts and 186.48 hours for parts coated with standard Pt/Al coatings. The time to rupture for coated 0.04"-gap parts was 153.34 hours (test at 2000°F and 3 Ksi). This compares favorably to the performance of undamaged parts made from MAR-M247, whether uncoated or coated with standard Pt/Al coatings.

FIG. 1 shows the results of S/R testing. As can be seen from the graph, the mechanical performance of parts repaired by the compositions and methods of the present invention compares favorably with the mechanical performance of undamaged MAR-M247 parts.

EXAMPLE 3

Low Cycle Fatigue Testing

Low cycle fatigue (LCF) tests were performed on representative base metals, and on articles repaired using a preferred embodiment of the inventive powder mixture and repair process. For the low cycle fatigue (LCF) tests, the test conditions were $1900^{\circ}F$, R = 0, 0.53% strain, and a frequency of 20 CPM for.

FIG. 2 shows the results of the LCF testing. As can be seen from the graph, the mechanical performance of parts repaired by the compositions and methods of the present invention compares favorably with the mechanical performance of undamaged MAR-M247 parts.

EXAMPLE 4

Cyclic Oxidation Testing

Cyclic oxidation tests were also performed on the brazed specimens using a cyclic oxidation test cycle of 2075°F for 50 minutes and fan cool at room temperature for 10 minutes. The specimens consisted of base material and brazed samples, both with compatible PtAl coatings.

The inventive braze alloy mixtures performed much better than prior art braze mixtures during the tests. The most preferred embodiments achieved a more than 10-fold improvement of oxidation properties over diffusion braze alloy systems due to the lower percentage of boron and the higher percentage of aluminum.

FIG. 3 shows the specific weight change during cyclic furnace oxidation test at 2075°F for 500 cycles. (Five hundred cycles was selected to as a reasonable approximation of target engine flight life.) Sample weight changes were in weight gain or weight positive gain but decreasing weight. The samples gain weight due to the formation of protective oxides, which are primarily aluminum oxides. Some oxide spelling-off could result in reduction in weight. But protective layers still remain on the surface and Al can diffuse from the braze mixture to the surface to form new protective oxide. Negative weight gain is not desirable, and almost never occurred in the 500 cycle tests.

5

10

15

20

25

WO 02/050323 PCT/US01/47838

17

As shown by the above, it is to be appreciated that the microstructure of joints brazed with the technology of the present invention contains very few, if any, phases that would be detrimental to the joint mechanical and oxidation properties. The inventive mixtures also possess acceptable level of braze voids after brazing process.

While the invention has been illustrated and described in detail in the drawings and foregoing description, the same is to be considered as illustrative and not restrictive in character, it being understood that only the preferred embodiment has been shown and described and that all changes and modifications that come within the spirit of the invention are desired to be protected.

BNSDOCID: <WO____0250323A3_IA>

5

15

20

25

30

18

CLAIMS

What is claimed is:

- 1. A braze alloy powder composition comprising: (a) at least one low-melt alloy powder, and (b) at least one high-melt alloy powder; wherein said at least one low-melt alloy powder comprises 50-70% Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to 2.25% B, and wherein said at least one high-melt alloy powder comprises 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, 2-4% Re, and up to 3% each of Mo and Hf.
- 2. A braze alloy powder composition according to claim 1 wherein said at least one low-melt alloy powder also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, W, Mo, Re, Nb, Hf, Pd, Pt, Ir, Ru, C, Si, and Zr.
 - 3. A braze alloy powder composition according to claim 1 wherein said at least one high-melt alloy powder also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, Nb, C, B, Si, and Zr.
 - 4. A braze alloy powder composition according to claim 1 wherein said at least one low-melt powder comprises about 57% Ni, about 17% Cr, about 12% Ta, about 6% Co, about 3.5% Al, and about 1.5% B.
 - 5. A braze alloy powder composition according to claim 1 wherein said at least one low-melt powder comprises a mixture of three low-melt alloy powders, including: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third low-melt powder comprising about 6% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B.
 - 6. A braze alloy powder composition according to claim 1 wherein said at least one high-melt powder composition comprises about 58% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.

10

15

20

- 7. A braze alloy powder composition according to claim 1 wherein said composition comprises about 45% of said at least one low-melt alloy powder and about 55% of said at least one high-melt alloy powder.
- 8. A braze alloy powder composition according to claim 1 wherein said composition comprises about 45% of said at least one low-melt alloy powder and about 55% of said at least one high-melt alloy powder, wherein said at least one low-melt alloy powder comprises a mixture of three low-melt alloy powders, including: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third low-melt powder comprising about 65% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 0.5% to 1.5% each of Re, Nb, Hf, and B; and wherein about 55% of a high-melt alloy powder comprising about 59% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, about 3% Re, about 1.5% Hf, and about 5% W.
 - 9. A braze alloy mixture consisting essentially of 50-70% Ni, 10-15% Cr, 8-10% Ta, 8-10% Co, 4-6% Al, 2-4% W, and about 1% each of Mo, Re, and Hf.
- 10. A braze alloy mixture consisting essentially of about 58% Ni, about 11% Cr, about 9% Ta, about 9% Co, about 5% Al, about 3% W, and about 1% each of Mo, Re, and Hf.
 - 11. A braze alloy mixture according to claim 8 wherein said mixture also comprises up to about 1% each of one or more members selected from the group consisting of: Ti, Nb, Pd, Pt, Ir, Ru, C, Si, B, and Zr.
- 12. A method of repairing an article made of a nickel-based superalloy material, said method comprising:
 - (a) providing a braze alloy powder composition comprising:
 - (i) at least one low-melt alloy powder, and
- (ii) at least one high-melt alloy powder;

 wherein said at least one low-melt alloy powder comprises 50-70%

 Ni, 8-20% Cr, 8-15% Ta, 4-10% Co, 2-7% Al, and up to 2.25% B;

 and

wherein said at least one high-melt alloy powder comprises 50-70% Ni, 2-10% Cr, 2-10% Ta, 5-15% Co, 2-10% Al, 2-10% W, and up to 3% each of Mo, Re, and Hf;

- (b) brazing a damaged portion of the article with said braze alloy powder composition, wherein said brazing is done at temperatures of between about 2150°F and about 2350°F.
 - 13. The method of claim 12 and further comprising the step of exposing the brazed article to a stepped diffusion cycle at temperatures of between about 1900°F and about 2100°F.
- 10 14. The method of claim 12 wherein said providing step comprises providing a braze alloy powder composition comprising about 45% of at least one low-melt alloy powder and about 55% of at least one high-melt alloy powder, wherein said at least one low-melt alloy powder comprises a mixture of three lowmelt alloy powders, including: (a) about 35% of a first low-melt powder comprising about 74% Ni, about 6% Cr, about 6% Al, about 12% Co, and about 15 2% B; (b) about 45% of a second low-melt powder comprising about 42% Ni, about 31% Cr, about 26% Ta, and about 1% B; and (c) about 20% of a third lowmelt powder comprising about 64% Ni, about 6% Al, about 8% Co, about 4% W, about 4% Ta, about 3% Si, about 1% Re, about 1% Nb, and about 1% B, and about 20 55% of a high-melt alloy powder comprising about 58% Ni, about 7% Cr, about 6% Ta, about 12% Co, about 6% Al, 2-4% Re, 1-2% Hf, and about 5% W.
 - 15. The method of claim 14 and further including the step of exposing the brazed article to a stepped diffusion cycle as follows:
 - a. Heat part to 1800-2000°F and hold for 0.5-4 hours;
 - b. Heat part to 1900-2100°F and hold for 1-4 hours;
 - c. Heat part to 1950-2150°F and hold for 1-4 hours;
 - d. Heat part to 2000-2200°F and hold for 6 to 24 hours; and
 - e. Cool to ambient temperature.
- 16. The method of claim 15 wherein the heating is preferably
 30 accomplished at a rate such that the first heating step is performed at a rate of
 about 20-40°F per minute, the second heating step is performed at a rate of about
 10-30°F per minute, the third heating step is performed at a rate of about 5-20°F


per minute, the fourth heating step is performed at a rate of about 5-20°F per minute.

- 17. The method of claim 15 wherein said stepped diffusion cycles is as
- follows: a. Heat to 1900°F at 30°F per minute and hold for 1 hour;
 - b. Heat to 2000°F at 20°F per minute and hold for 2 hours;
 - c. Heat to 2050°F at 10°F per minute and hold for 2 hours;
 - d. Heat to 2100°F at 10°F per minute and hold for 8 to 18


hours;

e. Cool at a rate effective to avoid thermal distortion.

BNSDOCID: <WO_____0250323A3_IA>

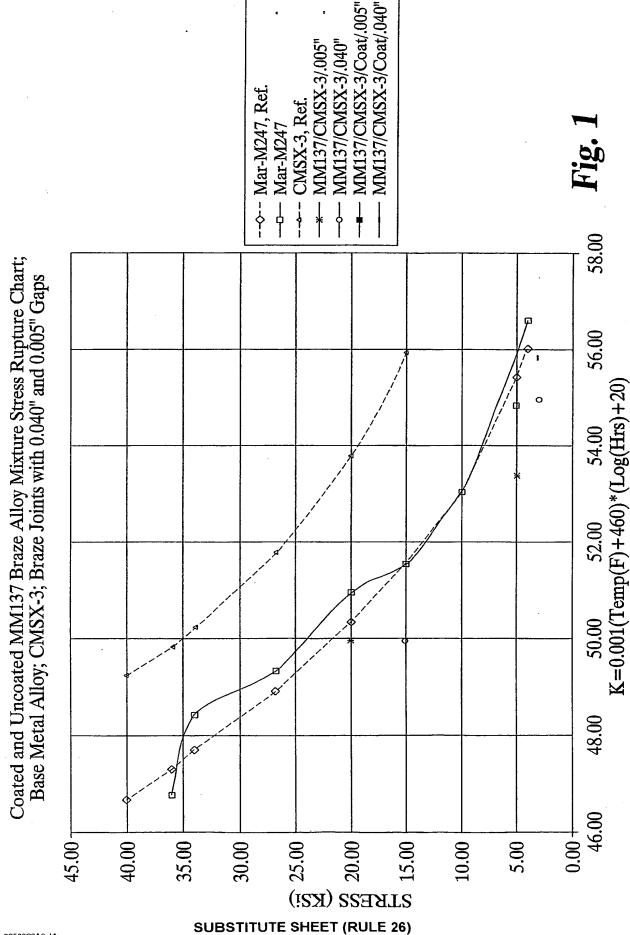

BNSDOCID: <WO 0250323A3 IA>

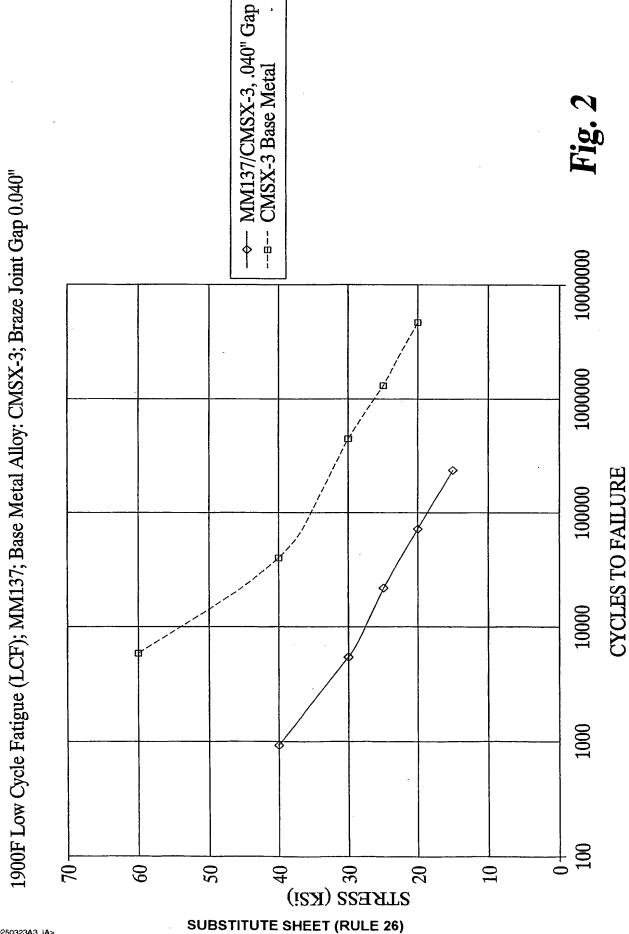

Cyclic Furnace Oxidation @ 2075 F

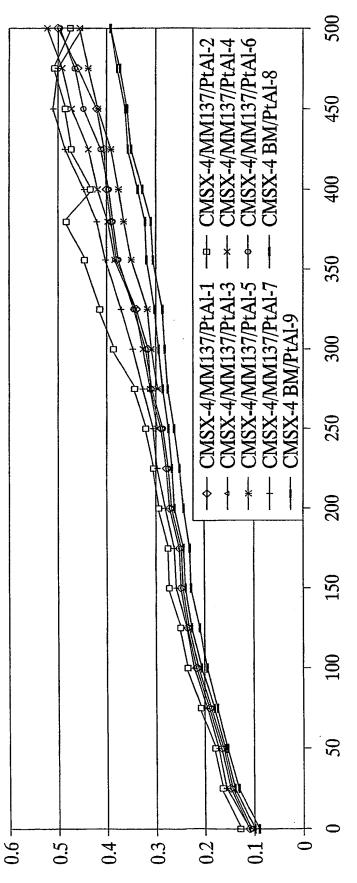


Fig. 3

Time (hours - cycles)

(95 atna) table atnitsans Specific Weight Change (mg/cm $^{\sim}$ 2)

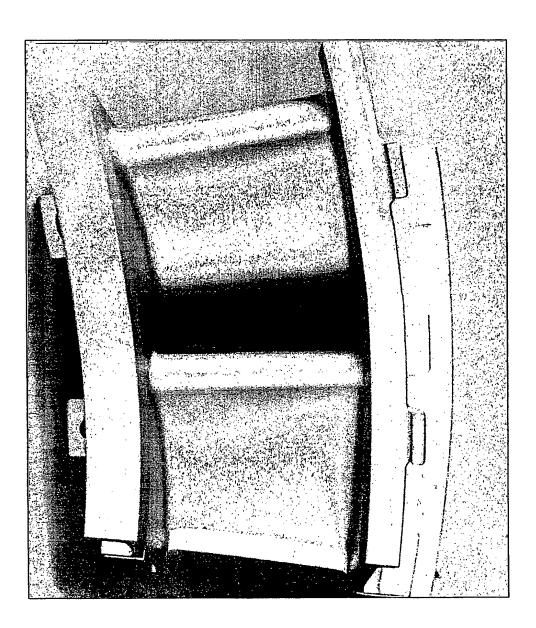


Fig. 4A

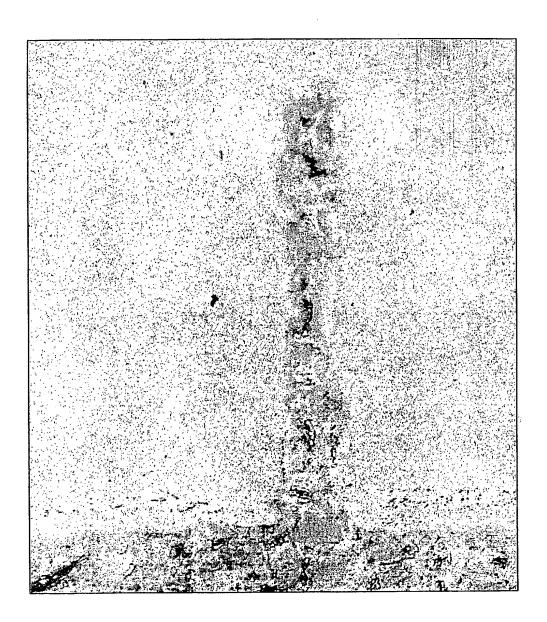


Fig. 4B

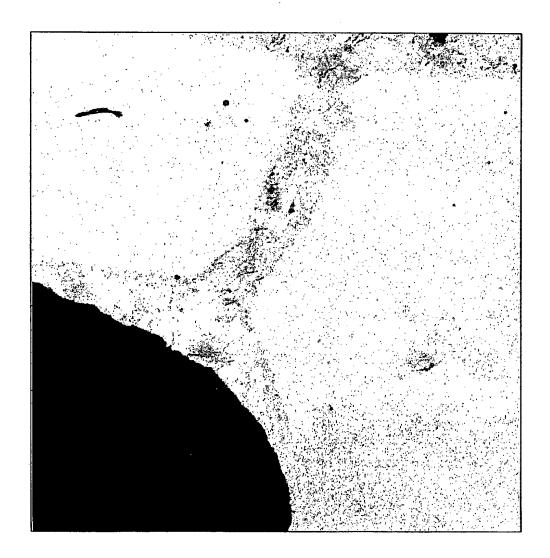


Fig. 4C

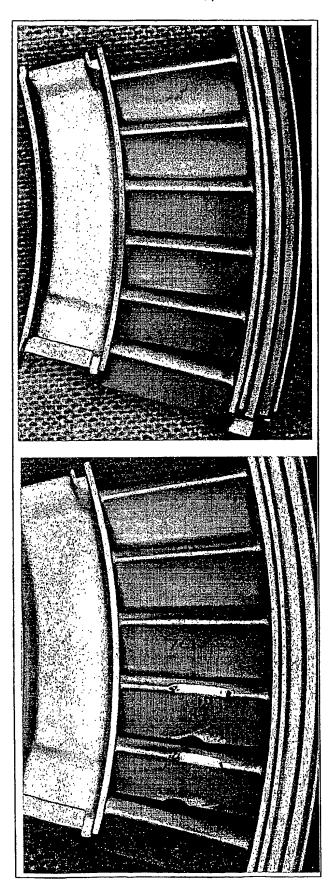


Fig. 5a

Leading edge sides of vane segment prior to and after braze repair.

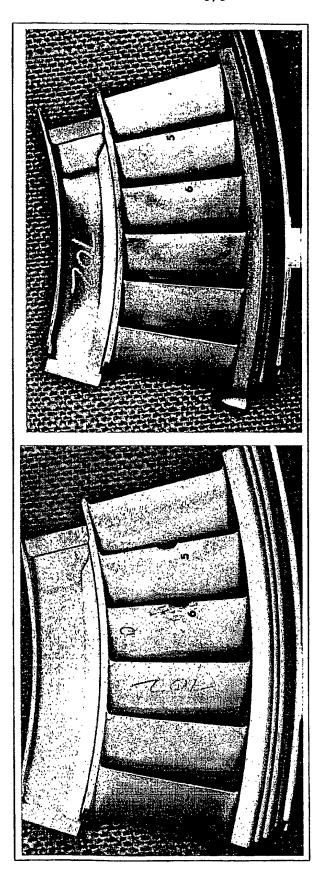


Fig. 5bTrailing edge sides of vane segment prior to and after braze repair.

INTERNATIONAL SEARCH REPORT

International application No. PCT/US01/47838

A. CLASSIFICATION OF SUBJECT MATTER										
. IPC(7)										
US CL : 75/255; 148/528; 228/262.31; 420/445 According to International Patent Classification (IPC) or to both national classification and IPC										
B. FIELDS SEARCHED										
Minimum docu	umentation searched (classification system followed	by classification symbols)								
U.S. : 75										
Documentation searched other than minimum documentation to the extent that such documents are included in the fields searched										
Electronic data base consulted during the international search (name of data base and, where practicable, search terms used)										
C. DOCUMENTS CONSIDERED TO BE RELEVANT										
Category*	Citation of document, with indication, where app	propriate, of the relevant passages	Relevant to claim No.							
	US 5,240,491 A (BUDINGER et al.)	_	9-11							
A	document. 1-8, 12-17									
	US 4,381,944 A (SMITH JR, et al.) 03 May 1983, see entire document.									
1	US 4,830,934 A (FERRIGNO et al.) 16 May 1989, see entire document.									
		·								
Further documents are listed in the continuation of Box C. See patent family annex.										
"A" docum	al categories of cited documents: ment defining the general state of the art which is not	"T" later document published after the into date and not in conflict with the appl the principle or theory underlying th	ication but cited to understand							
"E" earliei	dered to be of particular relevance or document published on or after the international filing date ment which may throw doubts on priority claim(s) or which is	"X" document of particular relevance; the considered novel or cannot be considered when the document is taken alone								
cited specia	se claimed invention cannot be step when the document is h documents, such combination									
"P" docum	means being obvious to a person skilled in the art "P" document published prior to the international filing date but later "&" document member of the same patent family than the priority date claimed									
	ctual completion of the international search	Date of mailing of the international se	arch report							
21 MAY 200	02	12 JUN 2902								
Name and mai Commissioner	iling address of the ISA/US r of Patents and Trademarks	Authorized officer	buf (Well)							
Box PCT Washington, I		george wyszomierski $/\mathcal{U}$	my liver							
Facsimile No.	•	Telephone No. (703) 308-2531								

THIS PAGE BLANK (USPTO)

This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

□ BLACK BORDERS
□ IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
□ FADED TEXT OR DRAWING
□ BLURRED OR ILLEGIBLE TEXT OR DRAWING
□ SKEWED/SLANTED IMAGES
□ COLOR OR BLACK AND WHITE PHOTOGRAPHS
□ GRAY SCALE DOCUMENTS
□ LINES OR MARKS ON ORIGINAL DOCUMENT
□ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY

IMAGES ARE BEST AVAILABLE COPY.

☐ OTHER:

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.

THIS PAGE BLANK (USPTO)